



**IMPORTANT SERVICE
INFORMATION FOR:**

- ✓ SERVICE MANAGER
- ✓ SERVICE ADVISOR
- ✓ TECHNICIAN
- ✓ PARTS DEPARTMENT
- ✓ WARRANTY PERSONNEL

BULLETIN NUMBER:
SB23-L-002

ISSUE DATE:
AUGUST 2023

GROUP:
FUEL & EXHAUST

DTC P2201/P20EE CALIBRATION UPDATE - REPROGRAM DEF CONTROL UNIT (DCU)

AFFECTED VEHICLES

- 2021MY Isuzu F-Series Vehicles

This bulletin supersedes information bulletin SB23-L-001. This bulletin is being revised to update diagnostic codes and calibration information. Please disregard previous bulletin SB23-L-001.

INFORMATION

The vehicle's Check Engine Malfunction Indicator Lamp (MIL) may illuminate with DTC P2201 and/or P20EE set in the DEF Control Unit (DCU). If one or both of the preceding DTCs are present, first follow the diagnostic for the DTC(s) in question. If no mechanical fault can be found during normal diagnosis, follow the service procedure in this bulletin to correct the concern.

SERVICE PROCEDURE

If the calibration part number does **NOT** match the calibration number listed in the table below, reprogram the DCU with the latest software and calibration using the Isuzu Diagnostic Service System (IDSS) version 15.0.9 or later:

MY	Vehicle	Engine	Calibration #
2021	F-Series	5.2L	55214580

NOTE: If the calibration number IS listed above, follow the Intermittent Conditions diagnostics in the appropriate Workshop Manual.

WARRANTY INFORMATION

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
L8005	CALI UPDATE REPRGM DCU P2201/P20EE	0.4