

August 31, 2023

Version 1

Warranty Extension: 2017 Accord 6AT Torque Converter – DTC P0741 Stored

AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2017	Accord	EX-L (V6), TRG (V6)	Check iN VIN status for eligibility.

BACKGROUND

The lock-up clutch cannot provide adequate holding force due to pressure bleeding down through a crack in the lock-up piston. The reduced lock-up clutch capacity results in the Malfunction Indicator Lamp (MIL) and set DTC P0741 *Torque Converter Clutch Circuit Performance or Stuck OFF*.

American Honda is extending the warranty on the torque converter to 8 years or 150,000 miles from the original date of purchase, whichever comes first.

CUSTOMER NOTIFICATION

Owners of affected vehicles will be sent a notification of this campaign.

Do an iN VIN status inquiry to make sure the vehicle is shown as eligible.

CORRECTIVE ACTION

Check the vehicle for DTC P0741, if DTC P0741 is set, replace the torque converter.

PARTS INFORMATION

Part Name	Part Number	Quantity
Torque Converter Kit	06260-5B7-000	1
Steering Joint Yoke Bolt	90135-SZT-000	1
Washer Bolt (10x25)	90167-SAA-010	2
Flange Bolt (12x45)	90165-SDA-A00	2
Flange Nut (12mm)	90371-SEF-000	2
Mass Nut (12mm)	90371-T2F-A01	2

CUSTOMER INFORMATION:The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

Part Name	Part Number	Quantity
Flange Bolt (10x30)	90161-T2F-A01	3
Castle Nut (14mm)	90363-S3V-A01	2
Hex Nut (12mm)	94030-12280	2
Flange Bolt (14x150)	90177-SDA-A00	2
Flange Bolt (12x33)	90186-SDA-A00	2
Flange Bolt (14x135)	90176-SDA-A00	2
Flange Bolt (10x30)	90163-SDB-A00	3
Flange Bolt (10x35)	90163-SDA-A01	2
Flange Bolt (12x70)	90051-R97-000	2

REQUIRED MATERIALS

Part Name	Part Number	Quantity
ATF DW-1	08200-9008	8

WARRANTY CLAIM INFORMATION

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
2181BM	Replace the torque converter. (includes DTC clear and alignment)	6.0 hr	6T800	YFL00	A23076A	26000-5B7-305

INSPECTION PROCEDURE

1. Check the vehicle for DTCP0741.
 - If DTC P0741 is set, go to the REPAIR PROCEDURE.
 - If DTC P0741 is not set, this service bulletin does not apply, continue with normal troubleshooting.

REPAIR PROCEDURE

1. Replace the torque converter assembly. Refer to the service information, in the Search field type in automatic transmission removal and installation, then select Automatic Transmission Removal and Installation.
2. Check the ATF level.

Automatic Transmission Fluid capacity

3.1L (3.3 US qt) at change, 7.2 L (7.6 US qt) at overhaul

COLD CHECK



HOT CHECK



3. Check the ATF temperature when greater than or equal to **80 degrees C (176 degrees F)**.
 - If the fluid level is checked at a colder temperature it will read low or on the bottom dot of the dipstick.
 - If the transmission fluid is filled to the top dot when cold, the transmission will be overfilled, increasing foaming and contributing to the overheating problem.

END