

## NOISY REAR DRIVE SHAFT ASSEMBLY

### Customer Voice:

- Clicking noise from rear, forward or reverse.

### Technical Description:

- Investigations have found a tooling concern with the rear half shaft nuts.

### Status:

- Please replace both half shaft nuts and use Loctite 638 on the threads.
- Torque to the specs below:
  - Stage 1: 300 Nm.
  - Stage 2: -90 deg.
  - Stage 3: 120 Nm.
  - Stage 4: 60 deg.
- TOPIx Workshop Manual Specifications are currently being updated

Refer to SSM 76049

### Range Rover

- 23MY Range Rover
- 23MY Range Rover Sport

### Discovery

- 23MY Discovery

### Defender

- 23MY Defender

