

MAS003745 RU 23-47

**RAPID UPDATE**

FROM: Maserati TSO

TO: Maserati Network



**Maserati**

PERSONAL SERVICE LAB

MASTERS OF CARE

# Rapid Update 659 Granturismo – Brake pad connector Check



DATE: AUGUST 4 2023

Certain Maserati GranTurismo (189) MY24 listed in MODISCS+ are involved in a Rapid Update to check the brake pad sensor connector.

This action is necessary because, on a small number of vehicles, the brake pad wear sensor connector may not have been inserted correctly into its seat. This could lead to disconnection of the connector with the risk of cable wear. This potential concern is not affecting the braking system functionality.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

**Please read and review this bulletin first before starting the procedure.**

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions. ([Maseratitechsupport@maserati.com](mailto:Maseratitechsupport@maserati.com))

Thank You for your continued support and cooperation.

Maserati Americas  
Aftersales Dept.

# Technical Procedure



All images shown in this bulletin are for illustrative purposes only

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Remove the front wheels following the procedure in the workshop manual.
  - **06.00.002 LH FRONT WHEEL RIM. Removal-Refitting**
3. Identify the pad wear sensor connector (A) on the caliper and push it all the way into its seat with your finger, checking that it is correctly inserted.



4. **Note:** If the connector has completely come out of its seat and shows signs of wear, it will be necessary to open a BOL as "SUPPORT REQUEST" and replace the pads.
5. Check on both sides of the vehicle.
6. Reassemble all the removed parts following the procedure in reverse order.
7. Procedure Complete.

## Warranty claim

Complete your warranty claim as follows:

Description	Code
Rapid Update Number	659
Warranty code	23
Fault Code code	063
Component Code	4.10.005
Operation Code <ul style="list-style-type: none"><li>▪ Check/repositioning (2 sides)</li></ul>	4.10.005.A (0.15 h)