

MAS003712 RU 23-38

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



PERSONAL SERVICE LAB

MASTERS OF CARE

Rapid Update 653

Granturismo – front hood striker bolt check



DATE: AUGUST 1 2023

Certain Maserati GranTurismo (189) MY24 listed in MODISCS+ are involved in a Rapid Update to carry out a procedure for checking the fasteners of both front hood strikers.

This action is necessary because, on a single case found at the Plant, only one fastener has been found with a lower torque per the data. This concern does not lead to a potential unexpected hood opening and no parts were found disconnected. The only potential consequence is related to some rattling noises due to the vibration. The procedure consists of a simple check with a torque wrench and possible torque tightening of the incorrect tightening. The expectation, however, it's not to find any vehicle with this concern.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before starting the procedure.

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions. (Maseratitechsupport@maserati.com)


Thank You for your continued support and cooperation.

Maserati Americas
Aftersales Dept.

Procedure

 All images shown in this bulletin are for illustrative purposes only

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Open the front hood and locate both hood strikers, located on both the front right and front left sides of the front hood.
3. **Use a torque wrench** to torque the two fasteners on each striker to **8 (eight) Nm**.

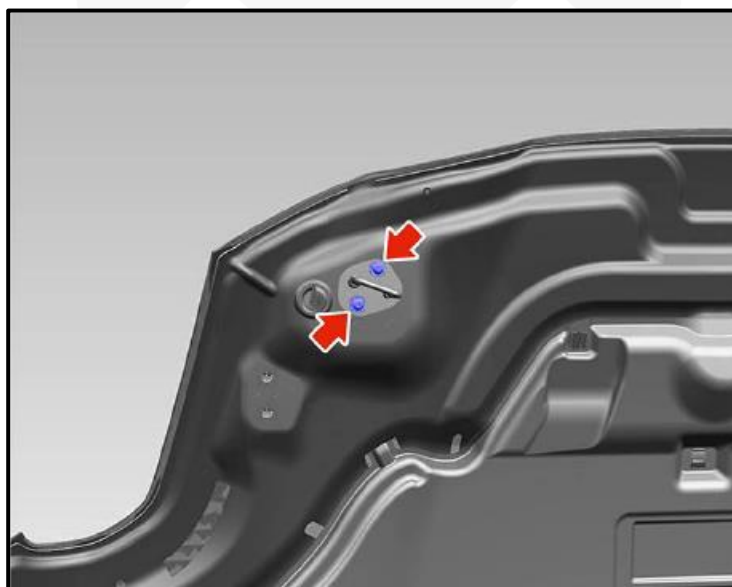

TORQUE SPECIFICATIONS	
Right Front Striker Fasteners	8 Nm (5.9 ft-lb)
Left Front Striker Fasteners	8 Nm (5.9 ft-lb)

4. Carry out the procedure for all 4 Hood striker fasteners.
5. The procedure is completed.

Warranty Claim

Fill in the relative Warranty Claims as follows:

Description	Code
Rapid Update Number	653
Warranty Code	23
Fault Code	063
Component Code	9.23.049
Operation Code	9.23.049.A (0,10 h)