



STAR ONLINE PUBLICATION




Case Number: S2305000002

Release Date: July 2023

Symptom/Vehicle Issue: Vacuum Pump Runs Continuous During Module Flash Or Is Inoperative After Recent Repair.

Technician Observation: Vacuum pump runs during flashing process of any module. The vacuum pump fuse may be blown and the pump is inoperative as a result.

Discussion: Service information and all publications are being updated to include an added necessary step of removing fuse F81 prior to flashing any module on GG Hornet or GC Tonale vehicles. Failure to do so may cause the vacuum pump to go into a default run mode during the flash. After flashes are complete, fuse F81 must be replaced.

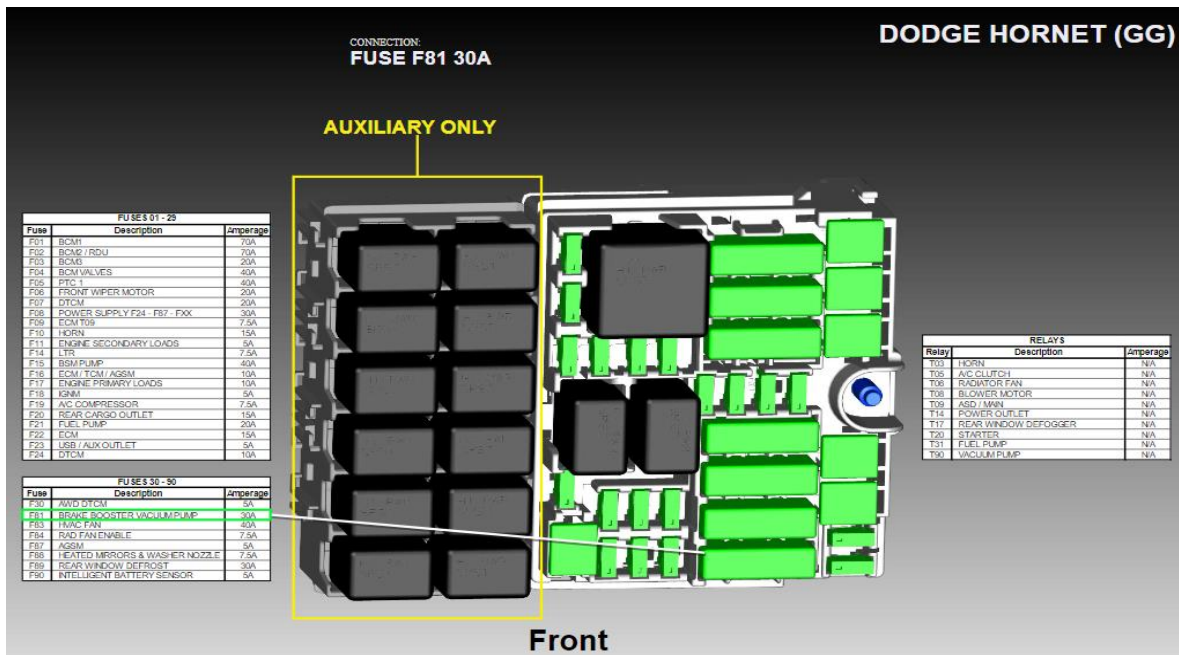

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.