

STAR ONLINE PUBLICATION















Case Number: S2308000093


Release Date: July 2023

Symptom/Vehicle Issue: Electric Start-Stop (ESS) Inoperative, Instrument Panel Cluster (IPC) Displays a Warning Message "ESS Not Available"

Owner Complaint/Technician Observation: The owner complains the vehicle's start-stop system does not operate. The IPC displays a message "ESS Not available". The technician viewed the vehicle is setting Diagnostic Trouble Code (DTC) P152F Hood Switch 2 / Hood Switch 1 Correlation.

Discussion: Inspect the hood switch and striker location as shown below for a missing or mispositioned striker. Replace the striker as needed, test the operation, and clear the Diagnostic Trouble Code (DTC) once stored Pg 1 and 2.



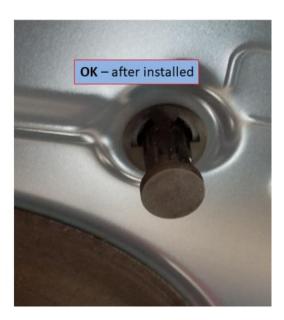

Pg 1

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found

FCA US LLC Version 4.3 10/29/2020



STAR ONLINE PUBLICATION
















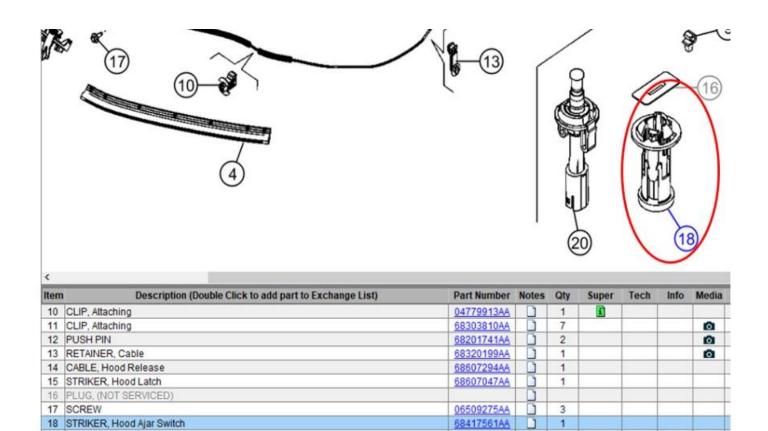

Pg 2

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found

FCA US LLC Version 4.3 10/29/2020