

REFERENCE:	TSB: 08-139-23 REV. A GROUP 08 - Electrical	Date:	July 18, 2023	REVISION:	08-139-23
VEHICLES AFFECTED:	2023 (DJ) RAM 2500 Pickup 2023 (D2) RAM 3500 Pickup 2023 (DD) RAM 3500 Cab Chassis 2023 (DF) RAM 3500 10K LB. Cab Chassis 2023 (DP) RAM 4500/5500 Cab Chassis This bulletin applies to vehicles built on and before May 20, 2023 (MDH 0520XX) equipped with a Global Telematics Box Module (Sales Code RDG).			MARKET APPLICABILITY:	
				<input checked="" type="checkbox"/> NA	<input type="checkbox"/> MEA
				<input type="checkbox"/> SA	<input type="checkbox"/> IAP
				<input type="checkbox"/> EE	<input type="checkbox"/> CH
CUSTOMER SYMPTOM:	Customers may experience one or more of the following: <ul style="list-style-type: none"> • Uconnect Box Message at startup. • Uconnect Box Error or Requires Service Message. • Connectivity: Diagnostic Trouble Codes (DTCs) for Electronic Control Modules (ECUs) won't be shown to customer through the Vehicle Health alert (Mobile app or email). 				
CAUSE:	TBM software.				

This bulletin supersedes Technical Service Bulletin (TSB) 08-139-23, date of issue June 09, 2023, which should be removed from your files. All revisions are highlighted with ****asterisks**** and include an updated software level and national launch date.

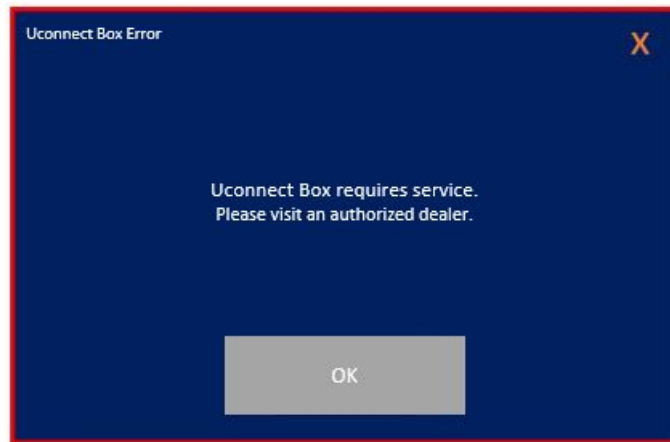


Fig. 1
Uconnect Box Error Message

Message display on the radio screen, “Uconnect Box requires service. Please visit an authorized dealer.” (Fig. 1) , with no active or stored DTCs set by the TBM.

NOTE: “Uconnect Box requires service.” message can be triggered by different reasons. For an issue on a new vehicle recently switched to customer mode, please follow the New Vehicle Preparation procedure to resolve the issue. For the customer vehicle with intermittent concerns, please check the TBM, antenna and instrument panel harness connections to fix related DTC issues.

REPAIR SUMMARY:

This bulletin provides information regarding the latest Firmware Over The Air (FOTA) update and provides the service technician an overview of the steps a customer will need to take to complete the update. The TBM software will be updated from **5.13 and** 5.25 to 5.39.1.

NOTE: The national launch for the FOTA is expected to begin **June 14, 2023.**

DISCUSSION:

Vehicles sold in the U.S. and Canada can now receive software updates “over-the-air”. Updates to software will occur in a phased roll-out. The software is updated through a built-in cellular modem in the vehicle. Customers will see a notification on their radio screen when new software is available for their TBM (Fig. 2) . The owner will have the option to update the radio or schedule the update for later. There is not an option to decline the update indefinitely, the update must be performed.

NOTE: This is an Information Only Technical Service Bulletin to inform the dealer how the FOTA update is performed. This document does not contain a LOP for reimbursement.

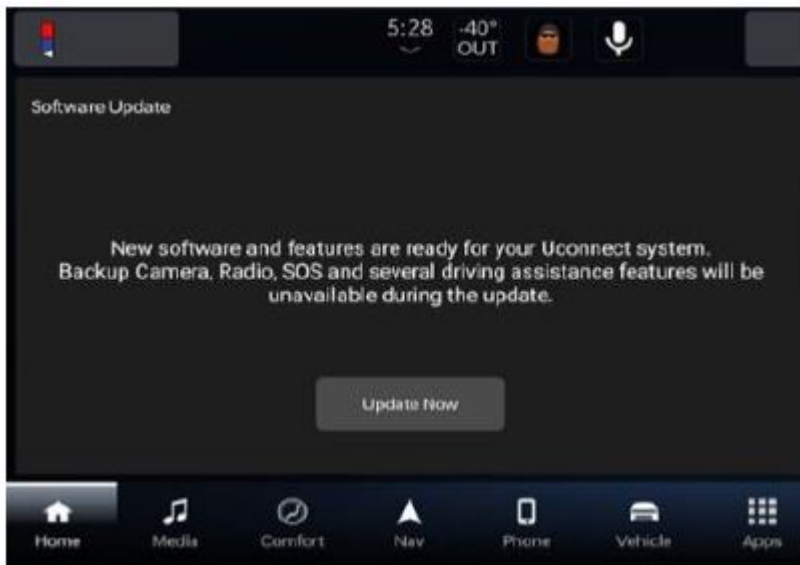


Fig. 2
Software Acceptance Screen

1. The vehicle needs to be in 'Park'. The ignition needs to be in the off position.
2. If the customer selects “Update Now” (Fig. 2) they can shut off the vehicle and leave. The update will be completed automatically.

NOTE: This step may take several minutes to complete.

3. Upon completion of update, the radio will display a confirmation message (Fig. 3) .

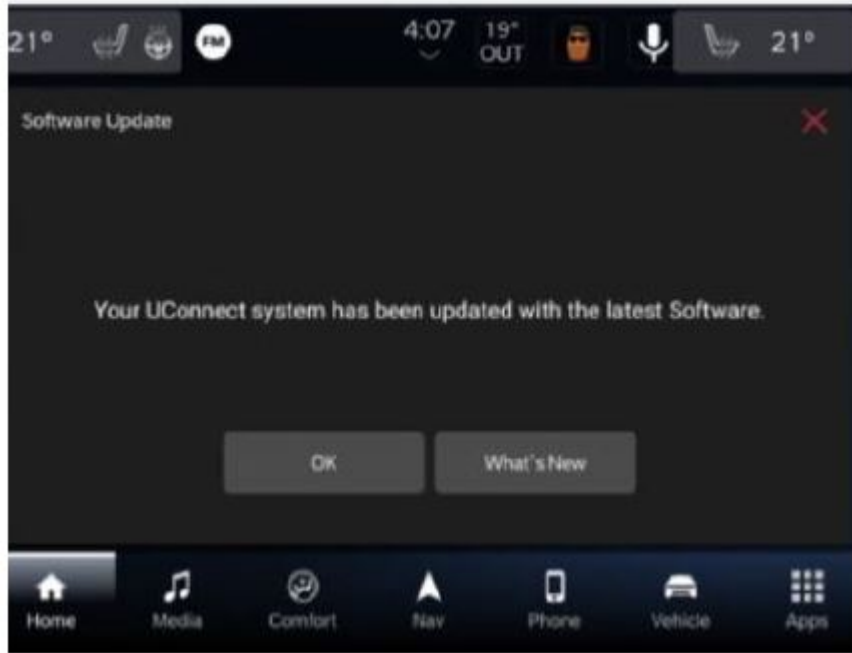


Fig. 3
Software Update Confirmation Screen

POLICY:
Information Only

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.