

#### Release date:

9/13/2023

## Condition

Applicable Vehicles					
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Golf R, GTI, Tiguan, Jetta, Arteon	2022-2023	All	All	All	All

Revision Table					
Instance Number	Published Date	Version Number	Reason For Update		
2070207/5	9/13/2023	48-23-01	Update to PR codes.		
2070207/3	8/14/2023	48-23-01	To include an additional labor operation.		
2070207/1	5/4/2023	48-23-01	Original publication.		

#### **Customer states:**

Various driver assist systems do not work/cannot be switched on. The following messages are shown in the display:

- Travel Assist currently not available.

or

- Emergency Assist limited availability.

## **Technical Background**

Hardware-related deviation of the sensor mat ("hands on detection") in the steering wheel and software-related deviation in the steering wheel touch detection control module -*J1158*-.



This bulletin only applies to vehicles with equipment (PR number) 2PD, 2PS, 2PE, 2FM, 2PT, 2FT, 1XT with one of the following: 6l2 or 6l6.

- 2PD: Multifunction sports steering wheel (leather)
- 2PS: Multifunction sports steering wheel (leather), heated
- 2PE: Multifunction sports steering wheel (leather), with tiptronic

<sup>© 2023</sup> Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



**Release date:** 9/13/2023

- 2PT: multifunction sports steering wheel (leather), heated with tiptronic
- 1XT: multifunction sports steering wheel (leather), heated with tiptronic
- 2FM: Multifunction steering wheel (leather), heated
- 2FT: Multifunction steering wheel (leather), heated with tiptronic
- 6I2: Lane Assist plus Traffic Jam Assist
- 6I6: Lane Assist plus Emergency Assist and Traffic Jam Assist

### **Production Solution**

Not applicable.

### **Service**

#### **Technician findings:**

• The customer statement cannot always be reproduced.

In the adaptive cruise control module (diagnosis address 0013) the following event entry is (sporadically/statically) logged:

- U112300: data bus, received error value
- Symptom: 2418

or

In the Gateway module (diagnosis address 0019) one of the following event entries is (sporadically/statically) logged:

- B17B8F2: control unit for steering wheel touch detection sensor fault
- Symptom: 8786912

or

• U133E00: control unit for steering wheel touch detection, no communication

```
- Symptom: 197438
```

or

One of the following event entries must be logged in the front camera for driver assist systems (diagnosis address 00A5, sporadic/static):

• U112300: data bus, received error value

```
- Symptom: 1124393
```

or

publisher.

- U112300: data bus, received error value
- Symptom: 1124477

<sup>© 2023</sup> Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the



Release date: 9/13/2023

# **I** Note:

If the event entries (see under technician findings) include other symptom numbers, this bulletin <u>does not</u> <u>apply</u>. In this case the costs for the repair cannot be accounted on this technical bulletin.

## Note:

When working on the airbag always observe the safety instructions in the repair manual.

Replace the steering wheel, enable operation of the control unit for multi-function steering wheel and the control unit for steering wheel touch detection.

#### Procedure:

- Remove the steering wheel according to the repair manual. See Repair Group 48 in Elsa.
- Install the new steering wheel according to the repair manual. See Repair Group 48 in Elsa.
- With Guided Fault Finding, enable the control unit for multi-function steering wheel and the control unit for steering wheel touch detection.
- Under "own test plan", select the diagnosis address "0019".
- In "test plan" operation mode, select the "LIN participants" function.

– In the "test plan" section, select and perform the "control unit for multi-function steering wheel start-up" function.

- In the "test plan" section, select and perform the "control unit for steering wheel touch detection startup" function.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



9/13/2023

## Warranty

To determine and Procedure			re is covered un	der Warranty, al	ways re	efer to the Warr	anty Policies
Model(s)	Yea	ır(s)	Eng. Code(s)	Trans. Code(s)	VIN	Range From	VIN Range To
Golf R, GTI, Tiguan, Jetta, Arteon	2022-2023		All	All	All		All
			SA	AGA Coding			
Claim Type:	Claim Type: Use applicable Claim Type <sup>1)</sup>						
Service Nun	nber:	ber: Code		HST	Damage Location (Depe on Service No.)		
4810			0040			Use applicable when indicate in Elsa (L/R)	
Parts Manufacturer		Golf R, GTI, Arteon			WG8		
		Jetta, Tiguan			3ME		
Labor Operation <sup>3)</sup> : Charge battery			27068950 = see Elsa for latest time units				
Labor Operation 3): Replace steering wheel			48105550 = see Elsa for latest time units				
Labor Operation <sup>3)</sup> : Steering wheel remove+install			48101950 = see Elsa for latest time units				
Labor Operation <sup>3)</sup> : Driver airbag unit remove+install			69581900 = see Elsa for latest time units				
Labor Operation <sup>3)</sup> : Battery ground strap			97850950 = see	Elsa fo	<mark>r latest time unit</mark>	s	
Causal Part:			4810****				
Diagnostic Time <sup>4)</sup>							
<b>GFF Time expenditure</b> 01500000 = Actua			ual GFF print out		YES		

© 2023 Volkswagen Group of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

Page 4 of 5



Release date: 9/

9/13/2023

Road Test	01210002 = 10 TU 01210004 = 10 TU	YES		
Technical Diagnosis.	01320000 = 00 TU max.	NO		
Claim Comment: Input "As per Technical Bulletin 2070207" in comment section of Warranty Claim.				
<sup>1)</sup> Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only.				
<sup>2)</sup> Code per warranty vendor code policy.				
<sup>3)</sup> Labor Time Units (TUs) are subject to change with ELSA updates.				
<sup>4)</sup> Documentation required per Warranty Policies and Procedures Manual.				

## **Required Parts and Tools**

Tool Description	Tool No:	
Midtronics Battery Tester/Charger	GRX3000VAS	
	or	
	MTRMSP0702 battery maintainer/charger	
VAS Diagnostic Tool	VAS 6150/X & VAS 6160/X and	
	ODIS Service with: current online updates	

## **Additional Information**

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.

© 2023 Volkswagen Group of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.