

STAR ONLINE PUBLICATION

Case Number: S2308000103

Release Date: August 2023

Symptom/Vehicle Issue: Service Air Suspension Message Displayed on Cluster

Customer Complaint/Technician Observation: The owner complains of a service air suspension message being displayed on the cluster. The technician observes the Air Suspension Control Module (ASCM) is setting Diagnostic Trouble Code (DTC) **C15D1-15-LEFT FRONT WHEEL ACCELERATION SENSOR-CIRCUIT SHORT TO BATTERY OR OPEN** active or stored.

Repair Procedure: Inspect the left front acceleration sensor connector D2558 for any signs of corrosion, clean and replace the connector as needed. Secure connections using the push-pull-push method and test the operation.

Connector repair kit if needed.
68507961AA



This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found