



STAR ONLINE PUBLICATION



Case Number: S2308000100

Release Date: August 2023

Symptom/Vehicle Issue: Multiple Warning Lights, Sealer Between Ground Stud G908A And Eyelet

Discussion: The vehicle may have multiple warning lights illuminated in the cluster. Upon scanning the vehicle for DTC's you may find U0402 - Implausible Data Received From TCM. This may be caused by sealer in between the G908A ground stud and eyelet.


Diagnosis: Locate the G908A ground under the hood on the passenger side fender. Inspect for excessive sealer which may inhibit circuit continuity.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found



STAR ONLINE PUBLICATION

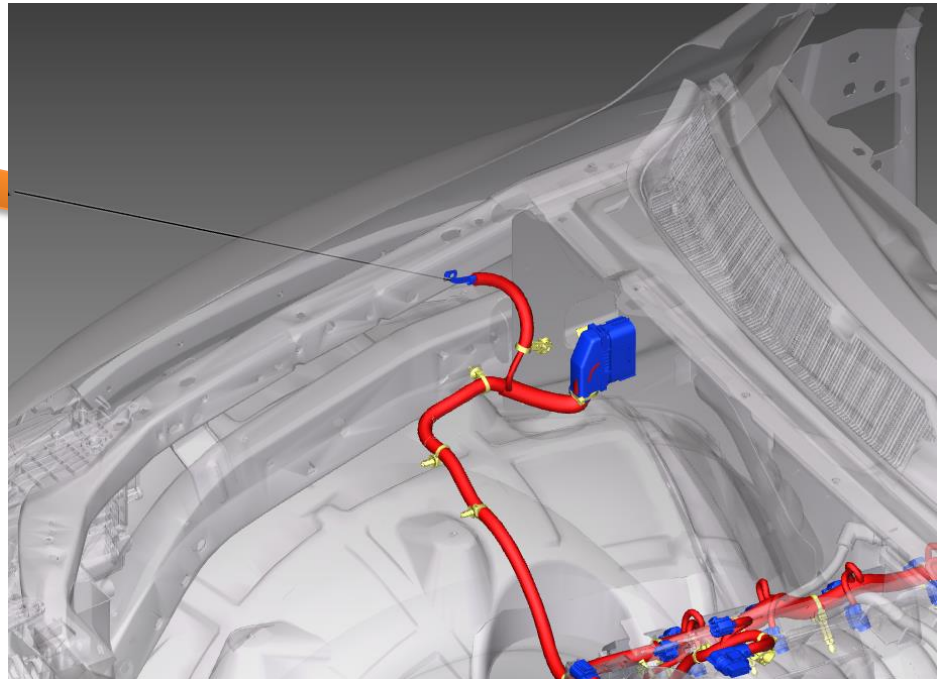

Yellow Sealant Shown On G908A Ground Stud Location

Repair: Using a wire brush or similar, remove any excessive sealant from the body ground stud and ground eyelet.

Verification: Verify the DTC's go stored and can be cleared. Confirm the vehicle no longer exhibits any concerns.

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found