

REFERENCE:	TSB: 23-090-23 GROUP 23 - Body	Date:	August 9, 2023	REVISION:	23-020-22 REV. A
VEHICLES AFFECTED:	**2019 -** 2021 (BV) Jeep Renegade This bulletin applies to vehicles built on or before February 09, 2022 (MDH 0209XX) equipped with Dual-Pane Panoramic Power Sunroof (Sales Code GWJ).			MARKET APPLICABILITY: <input type="checkbox"/> NA <input type="checkbox"/> MEA <input type="checkbox"/> SA <input checked="" type="checkbox"/> IAP <input type="checkbox"/> EE <input type="checkbox"/> CH	
CUSTOMER SYMPTOM:	Noise when closing the sunroof glass.				
CAUSE:	Wind deflector sliding pad disengagement.				

This bulletin supersedes Technical Service Bulletin (TSB) 23-020-22 REV. A, date of issue June 24, 2022, which should be removed from your files. All revisions are highlighted with ****asterisks**** and include updated model years and LOPs.

This Technical Service Bulletin (TSB) has also been released as a Rapid Service Update (RSU) 22-106, date of issue June 11, 2022. All applicable RSU VINs have been loaded. To verify this RSU service action is applicable to the vehicle, use VIP or perform a VIN search in DealerCONNECT/Service Library. All repairs are reimbursable within the provisions of warranty. This RSU will expire 18 months after the date of issue.

REPAIR SUMMARY:

This bulletin includes inspecting the sunroof wind deflector for noise when closing and replacing the wind deflector if required.

CLAIMS DATA:

Labor Operation No:	Labor Description	Skill Category	Labor Time
**23-30-66-97	Deflector, Sunroof - Inspect (2 - Skilled)	6 - Electrical and Body Systems	0.2 Hrs.
23-30-66-98	Deflector, Sunroof - Inspect and Replace (2 - Skilled)	6 - Electrical and Body Systems	1.2 Hrs.**
Failure Code	ZZ	Service Action	

SPARE PARTS:

Qty	Part No.	Description	Notes
1 (AR)	68266048AA - Mopar 77367192 - IAP	Deflector, Sunroof	Deflector, with Curtain (Sunroof)

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RSU VIN list, perform the Inspection Procedure. **This RSU only applies to vehicles on the RSU VIN list.**

1. Open and close the sunroof glass five times. Does the sunroof make an abnormal noise when closing?
 - YES>>> Proceed to [Step 1](#) of the Repair Procedure.
 - NO>>> This bulletin has been completed. Use Inspect LOP ****(23-30-66-97)**** to close the active RSU.

REPAIR PROCEDURE:

1. Replace the sunroof wind deflector. Refer to the detailed service procedures available in DealerCONNECT>Service Library under: 23 - Body / Sunroof, Dual Pane / Deflector, Wind / Removal and Installation.

POLICY:

Reimbursable within the provisions of the warranty.

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.