

# Technical product information

<b>Topic</b>	All Vehicle Variants - Spurious DTC List
<b>Market area</b>	Australia E04 Bentley rest Asia and Australia (6E04),China 723 Volkswagen (Anhui) Automotive CO (6723),China 796 VW Import Comp. Ltd (Vico), Beijing (6796),Germany E02 Bentley rest Europe (6E02),Japan E03 Bentley Japan (6E03),Korea, (South) E08 Bentley South Korea (6E08),United Arab Emirates E06 Bentley Middle East and Africa (6E06),United Kingdom E01 Bentley UK (6E01),United States E05 Bentley USA and rest America (6E05)
<b>Brand</b>	Bentley
<b>Transaction No.</b>	2053177/19
<b>Level</b>	EH
<b>Status</b>	Approval
<b>Release date</b>	

## New customer code

Object of complaint	Complaint type	Position
vehicle service -> vehicle diagnosis -> guided fault finding	control units, services -> with event log entry	

# Vehicle data

## All vehicle variants

### Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
*	2004	E		*	*	*
*	2005	E		*	*	*
*	2006	E		*	*	*
*	2007	E		*	*	*
*	2008	E		*	*	*
*	2009	E		*	*	*
*	2010	E		*	*	*
*	2011	E		*	*	*
*	2012	E		*	*	*
*	2013	E		*	*	*
*	2014	E		*	*	*
*	2015	E		*	*	*
*	2016	E		*	*	*
*	2017	E		*	*	*
*	2018	E		*	*	*
*	2019	E		*	*	*
*	2020	E		*	*	*
*	2021	E		*	*	*
*	2022	E		*	*	*
*	2023	E		*	*	*
*	2024	E		*	*	*

# Documents

Document name
<a href="#">master.xml</a>
<a href="#">spuriousdtclisttpi205317719.xlsx</a>

**Customer statement / workshop findings**

Customers will not be aware of any fault codes

Workshop may discover spurious fault codes whilst running a Diagnostic Trouble Code (DTC) log as part of other investigations on the vehicle

**Technical background**

The operative should refer to the Bentley Hub referencing TPI 2053177/-

The document (loaded onto the Hub) contains all of the current known Spurious DTC's for all vehicle variants

Should a particular TPI be listed as Archived, the TPI can no longer be viewed within Elsa pro, in this case please refer to the instructions within TPI 2053177/- regarding the DTC description and actions which should be conducted (if any)

**Production change**

Not applicable

**Measure**

During routine diagnostic interrogation of vehicle systems use the document (loaded onto the Hub) to determine the course of action to be taken

## Technical Product Information (TPI) - Diagnostic Trouble Codes (DTC)

TPI Reference Number	Vehicle Type	Model Year	DTC Reference Number	DTC Description	Diagnostic Address Effected	Measure
2035753/2	4W21*	2014	00477 004	Information display control head control module fr. -J523, at comf.CAN No signal/comm	34 - Level control system	If no actual fault is present DTC to be ignored
2035753/2	4W21*	2014	00928 to 00931	Lock unit for central locking	46-Central module comfort system	If no actual fault is present DTC to be ignored
2029651/1	393*, 394*, 3W*	2012, 2013	00941	Potential misleading DTC	Module 46 - J393	To be ignored if there is no loss of function on mirror system
2029651/1	393*, 394*, 3W*	2012, 2013	00942	Potential misleading DTC	Module 46 - J393	To be ignored if there is no loss of function on mirror system
2036267/1	39*, 3W*, 4W*	2004-2018	01592 014	At low ambient temperatures a spurious fault code may be logged by the HVAC control module	08 - Air Conditioner/heater electronics	If no actual fault is present DTC to be ignored
2035753/2	4W21*	2014	03163 004	Information electronics control module 2, No signal/communication static	19 - Gateway	If no actual fault is present DTC to be ignored
2033593/3	393*,394*, 4W21*	2012- 2014	03210	Sensitivity issues in TV Tuner can result fault codes which aren't necessary	0057- Tv Tuner	If no actual fault is present DTC to be ignored
2033593/3	393*,394*, 4W21*	2012- 2014	03211	Sensitivity issues in TV Tuner can result fault codes which aren't necessary	0057- Tv Tuner	If no actual fault is present DTC to be ignored
2033593/3	393*,394*, 4W21*	2012- 2014	03212	Sensitivity issues in TV Tuner can result fault codes which aren't necessary	0057- Tv Tuner	If no actual fault is present DTC to be ignored
2033593/3	393*,394*, 4W21*	2012- 2014	03213	Sensitivity issues in TV Tuner can result fault codes which aren't necessary	0057- Tv Tuner	If no actual fault is present DTC to be ignored
2035753/2	4W21*	2014	03230 010	Video connection to rear seat entertainment (RSE) open /short circuit	57 - TV Tuner	If no actual fault is present DTC to be ignored
2035753/2	4W21*	2014	03766 008	Seat belt height adjustment motor implausible signal -	06- Seat adjustment passenger side	If no actual fault is present DTC to be ignored
2035753/2	4W21*	2014	03766 008	Seat belt height adjustment motor implausible signal	36- Seat adjustment drivers side	If no actual fault is present DTC to be ignored
2029735/4	39**, 3W**, 4W21*	2012-2017	862 007	A spurious DTC can be stored in the (RNS)	Address 37 , Address 56 (RNS)	DTC to be ignored
2035753/2	4W21*	2014	B105313	GSM antenna - Open Circuit	7F- control unit 2 for information electronics	If no actual fault is present DTC to be ignored
2035753/2	4W21*	2014	B129731	Display 1,636, no signal/communication	7F- control unit 2 for information electronics	If no actual fault is present DTC to be ignored
2035753/2	4W21*	2014	B1297F2	Multimedia display unit 1 - upper temperature limit exceeded	7F- control unit 2 for information electronics	If no actual fault is present DTC to be ignored
2035753/2	4W21*	2014	B1297F3	Multimedia display unit 1 - lower temperature limit exceeded	7F- control unit 2 for information electronics	If no actual fault is present DTC to be ignored
2035753/2	4W21*	2014	B129831	Display 2, 640, no signal/comm	7F- control unit 2 for information electronics	If no actual fault is present DTC to be ignored
2035753/2	4W21*	2014	B1298F2	Multimedia display unit 2- upper temperature limit exceeded	7F- control unit 2 for information electronics	If no actual fault is present DTC to be ignored
2035753/2	4W21*	2014	B1298F3	Multimedia display unit 2- lower temperature limit exceeded	7F- control unit 2 for information electronics	If no actual fault is present DTC to be ignored
2035753/2	4W21*	2014	B163204	DVD 1 R161 Defective	7F- control unit 2 for information electronics	If no actual fault is present DTC to be ignored
2035753/2	4W21*	2014	B163304	DVD 2 R275 Defective	7F- control unit 2 for information electronics	If no actual fault is present DTC to be ignored
2035753/2	4W21*	2014	B163331	No internal network connection Loader (R161)-Loader (R275)	7F- control unit 2 for information electronics	If no actual fault is present DTC to be ignored
2035753/2	4W21*	2014	B163501	SIM Reader - J829, electrical defect in circuit	7F- control unit 2 for information electronics	If no actual fault is present DTC to be ignored
2035753/2	4W21*	2014	B163704	Battery poor health	7F- control unit 2 for information electronics	If no actual fault is present DTC to be ignored
2043466/3	4V1	2017 Onwards	B1928F0	Due to software maturity on selected ECUs the following code may be seen	09 - Central Electrics (BCM1)	If no actual fault is present DTC to be ignored
2035753/2	4W21*	2014	B200000	Control module defective	7F- control unit 2 for information electronics	If no actual fault is present DTC to be ignored
2046936/1	4V1	2017 Onwards	B200047	Vehicles with Light control software version 0012 and hardware H05 may store a spurious DTC	0029 - Light Control Left , 0039 - Light control right	If no actual fault is present DTC to be ignored
2050647/2	4V1	2017 Onwards	BF200E	During specific driving conditions the Bentley dynamic ride system warning may momentarily display	Roll bar Actuators D4 and D5	If no actual fault is present DTC to be ignored with symptom 12677125C17005 set as passive or sporadic.
2052626/1 - Archived	3S3*3S4*4V1*	2017 Onwards	U101100 000	Supply voltage - lower limit exceeded	0029- Light Control Left , 0039 - Light Control Right	If no actual fault is present DTC to be ignored
2030992/3	39**, 3W* 4W21*	( 39**/3W*)2012-2013 (4W21*) 2014-2016	U105300	A change to the voltage regulator componment in the alternator leads to the DTC to appear	Battery Management Control Unit	Unless related problem DTC to be ignored
2035753/2	4W21*	2014	U105C00	TV tuner - No communication	7F- control unit 2 for information electronics	If no actual fault is present DTC to be ignored
2048536/1	4V1	2017 Onwards	U132900	Sunlight photo sensor code is to be considered spurious in relation to faults or reports	08 - Air Conditioning control unit	If no actual fault is present DTC to be ignored
2043466/3	4V1	2017 Onwards	U20003_IPA_	Due to software maturity on selected ECUs the following code may be seen	07- Display Control Unit	If no actual fault is present DTC to be ignored
2033593/3	393*,394*, 4W21*	2012 Onwards	Various	Sensitivity issues in TV Tuner can result fault codes which aren't necessary	0057- Tv Tuner	If no actual fault is present DTC to be ignored
2051519/2	3S3*3S4*ZG2	2018 Onwards	Various	A number of spurious DTC's	08- Air conditioning	If no actual fault is present DTC to be ignored
2052496/1	3S3*3S4*	2018 Onwards	Various	A number of spurious DTC's	09 - Central Electrics	If no actual fault is present DTC to be ignored
Not applicable	3S3*3S4*	2018 Onwards	P26F400	Coolant pump circuit DTC	01 - Engine control Module	If no actual fault is present DTC to be ignored
2053177/7	ZG2*	2020 Onwards	U112100	Databus missing message	00D6 Light control Left - 00D7 Light Control Right	If no actual fault is present DTC to be ignored
2053177/8	3S3*3S4*ZG2	2018 Onwards	\$20280/131712	Timeout_Node_0x80_DiagAdress_74_EFP	0019 - Gateway	If no actual fault is present DTC to be ignored
Not applicable	3S3*3S4*4V1*ZG2	2020 Onwards	DTC U101400	Control module incorrectly coded	0075 - Emergency call module and Communication ur	If no actual fault is present DTC to be ignored
Not applicable	4V1	2020 Onwards	B14EB01	Garage door opener	09 - Central Electrics (BCM1)	If no actual fault is present DTC to be ignored
2068301/- and 2066511/-	ZG2*ZV1*3S3*3S4	2020 Onwards	C11D192	Symptom code 122 - Sporadic DTC flagged for the Rear Axle Steering Malfunction	00CB	If no actual fault is present DTC to be ignored
2063297/-	4V14A9	2017 to 2020 M/Y (W12 only)	C113107 and or C113207	Symptom Code 784 and or 785 - Assembly mounting malfunction	00BA	Refer to TPI 2063297/-
2052496/-	3S3	2018 to 2022 M/Y	Spurious (Numerous)	A number of spurious DTC's	09 - Central Electrics (BCM1)	Refer to TPI 2052496/-
2067729/-	Bentayga and Bentayga EWB	23 Onwards	U112100	Vehicle positioning system Interface control	46-Central module comfort system	If no actual fault is present DTC to be ignored
2067729/-	Bentayga, Bentayga EWB, New Flying Spur, New GT and New GTC	23 M/Y only	P056000	System Voltage malfunction	Gateway (Address 19)	If no actual fault is present DTC to be ignored
2067729/-	Bentayga and Bentayga EWB	21 Onwards	U010000	Lost communication with ECM/PCM	Gateway (Address 19)	If no actual fault is present DTC to be ignored
2067729/-	Bentayga and Bentayga EWB	23 Onwards	U112200	Databus implausible message	Voltage converter (Address C4)	If no actual fault is present DTC to be ignored
2067729/-	Bentayga EWB	23 Onwards	B196331	Fan 1 for left rear seat backrest No signal	08- Air conditioning	If no actual fault is present DTC to be ignored
2067729/-	Bentayga EWB	23 Onwards	B196431	Fan 2 for left rear seat backrest No signal	08- Air conditioning	If no actual fault is present DTC to be ignored
2067729/-	Bentayga EWB	23 Onwards	B196731	Fan 1 for right rear seat backrest No signal	08- Air conditioning	If no actual fault is present DTC to be ignored
2067729/-	Bentayga EWB	23 Onwards	B196707	Fan 1 for right rear seat backrest mechanical malfunction	08- Air conditioning	If no actual fault is present DTC to be ignored
2067729/-	Bentayga EWB	23 Onwards	B196931	Fan 1 for right rear seat cushion No signal	08- Air conditioning	If no actual fault is present DTC to be ignored
2067729/-	Bentayga EWB	23 Onwards	B196907	Fan 1 for right rear seat cushion mechanical malfunction	08- Air conditioning	If no actual fault is present DTC to be ignored
Not applicable	Bentayga	17 to 20 only	U154300	Data bus missing message	07-Display Control Unit	If no actual fault is present DTC to be ignored
2070750/-	3S3,3S3,ZG2	From VIN SCBCG22G3RC012498	B200DF0	Function restriction due to internal communication error	Infotainment electronics control unit J794	Please refer to TPI 2070750/-