

COOLING FAN INOPERABLE / MALFUNCTION – P4

Customer Voice:

- Cooling fan may intermittently fail to operate, causing a potential engine-overheat condition.

Technical Description:

- Diagnostic Trouble Code (DTC) P0480-13 will be stored in the Powertrain Control Module (PCM).

Status:

- Renewing the engine cooling fan with the current level parts will NOT rectify the customer's concern. A new level engine cooling fan will soon be released.
- In the interim, to prevent the above symptoms from becoming present, advise the customer that the ignition must be switched ON within 15 seconds of the driver's door being unlocked and opened.
- If the above symptoms are already present, then the below steps must be completed in order to temporarily rectify the concern:
 1. Turn the engine and ignition OFF
 2. Lock the vehicle.
 3. Wait for a minimum of 7 minutes.
 4. Unlock the vehicle, open the driver's door and turn the ignition ON within 15 seconds


Refer to SSM 76075

Defender

- 23MY Defender

Discovery

- 23MY Discovery

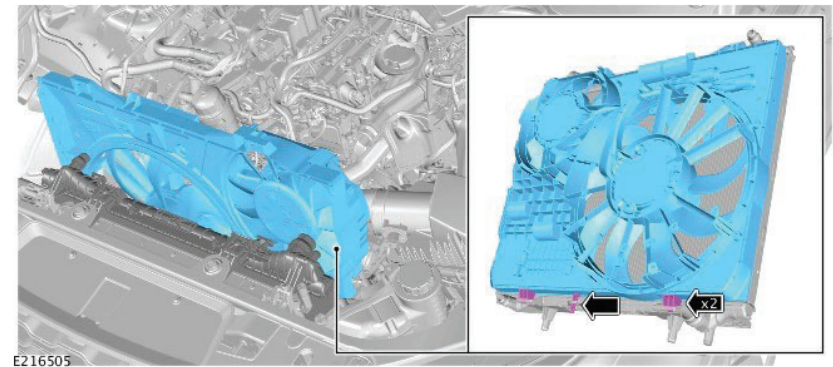

E216505