

Reference	SSM76076
Models	Defender / L663
Title	Front Headlamp Washer Jet Leaking / Rear Camera Washer Jet Leaking
Category	Body
Last modified	05-Sep-2023 00:00:00
Symptom	102000 Window/Glass

Content**Model / Model Year / Derivative**

Defender (L663) / 20MY Onwards / 90-110-130

Situation:

JLR Engineering investigations have found the headlamp washer jets / rear camera washer jet dripping/leaking.

Cause:

Washer jet feed pipe(s) one way valve is faulty not sealing.

SERVICE INSTRUCTION:

- Connect the JLR approved diagnostic equipment and the JLR approved battery support unit.
- Launch Diagnosis Device Agent, and log in.
- Select 'Fault and Breakdown'.
- Select 'Diagnose a fault'.

Rear Camera Washer Jets.

- Enter the following Symptom: (Body> Wiper & Washer> Rear> Washer Fluid Leak).
- Select the following test from the test plan (Leak From Rear Camera Washer Jet - Test> Run> Complete Step).
- Follow the on-screen instructions.
- If the test recommends the rear camera washer hose to be replaced.
- Part Number (All derivatives LR147412).

Headamp Washer Jets.

- Enter the following Symptom: (Body> Wiper and Washer> Headlamp Washer Jets> Washer Fluid Leak).
- Select the following test from the test plan (Leak From Headlamp Washer Jets - Test> Run> Complete Step).
- Follow the on-screen instructions.
- If the test recommends the headlamp washer hose to be replaced.
- Part Numbers: (LR132136 Except V8 S/C 5.0L) (V8 S/C 5.0L LR156927).

(Ref 000367454)

(Ref 000362732)

anBhdHRlcniM7MjAyMy0wOS0wOFQxMzozODowN40NTRaOzEzNk4yMjYyNzQuMTEzOw==