

**Volvo Car USA LLC****Parts Bulletin**

Bulletin Title	Group	CAT/NO
Service Action A10246 Leaf Spring Inspect-Repair Model Year: 2023 S60, V60, V60CC, V90CC, S90L, XC60 and XC90	72	A10246
Car Market	Issue Date	Status Date
United States and Canada	9/26/23	9/26/23
Revisions	Page	
	Page 1 of 2	

Reference Bulletin: QB A10246

Volvo Car USA LLC and Volvo Car Canada LTD, on behalf of Volvo Car Corporation, has decided to launch Active Service Action A10246 on certain Model Year 2023 S60, V60, V60CC, V90CC, S90L, XC60 and XC90 vehicles.

Volvo Cars quality investigations have identified that the wrong tool parameter setting was used during rear leaf spring production on vehicles built with rear leaf spring suspension. As a result, the rear suspension leaf spring may break.

In the unlikely event this should occur, Customers may complain of lowered vehicle ride height in the rear, harsh/bumpy ride, or noise from the rear of the vehicle while driving. Volvo has not received any reports alleging injuries, fatalities, or crashes related to this condition.

The corrective action is to inspect the leaf spring and only replace if the matching serial number is found in the Serial Number Matrix located in TIE.

A10246 affects 7,391 vehicles in the U.S. and 259 in Canada.

Part Number	Description	Qty
987735	Flange Screw	0-1
988876	Flange Screw	0-1
30622868	Sems Screw	0-2
30622916	Sems Screw	0-2
30640745	Flange Lock Nut	0-1
30640924	Flange Screw	0-3
30670592	Flange Screw	0-2
30670621	Flange Screw	0-2
30746511	Sems Screw	0-3
30746515	Sems Screw	0-4
30746634	Flange Screw	0-1
30746656	Sems Screw	0-2
30746769	Sems Screw	0-2
32370037	Leaf Spring	0-1

Part Number	Description	Qty
32370038	Leaf Spring	0-1
32370039	Leaf Spring	0-1
32370041	Leaf Spring	0-1
32370044	Leaf Spring	0-1
32370045	Leaf Spring	0-1