

Release date: 10/17/2023

## Condition

Applicable Vehicles						
Model(s) Year		Eng. Code Trans. Code		VIN Range From	VIN Range To	
Golf R, GTI	2022 - 2024	All	All	All	All	

Revision Table						
Instance Number	Published Date	Version Number	Reason For Update			
2069487/4	10/17/2023	94-23-01	Update to model year applicability.			
2069487/2	4/6/2023	94-23-01	Update to part quantity.			
2069487/1	2/15/2023	94-23-01	Original publication.			

## **Technical Background**

Incorrect assembly of the rubber lip/seal in the assembly process. This can result in damage to the locking lug. As a result of the damage to the locking lug, the rubber lip/seal comes loose or protrudes.

This procedure will help and eliminate the need for headlamp replacement.

# INote:

Headlamp assembly replacements with this concern could be subjected to debiting upon review.

## **Production Solution**

Not applicable.

## Service

#### Glue the rubber lip/seal

The rubber lip/seal (see Figure 1, red arrow) between the headlamp and the fender (left/right) is loose/detaching/is off.

<sup>© 2023</sup> Volkswagen Group of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Release date: 10/17/2023



Figure 1.

#### Procedure for gluing the rubber lip/seal:

#### Prepare rubber lip/seal:

Remove headlamp assembly. See repair manual Group 94 in Elsa.

Thoroughly clean the adhesive surface of the rubber lip/seal with isopropanol/water (mixing ratio: 50/50). Air the adhesive surface well. PN# D--009-40-104.



Use only 91%+ Isopropyl alcohol as a cleaner (9% water). Always allow cleaner to fully evaporate prior to starting the installation. Do not use Isopropyl with any additional surfactants (cleaners) or additives (scents). All installation areas must be completely free of any detergent, wax or detailing residue for proper adhesion.

Shake adhesion promoter/plastic primer (D 181220A1) well before use. Apply thinly and evenly with a sponge brush (see figure 2, part number: D 009 500 25) to the adhesive surface of the seal. Flash-off time 3min.

© 2023 Volkswagen Group of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Release date: 10/17/2023



Figure 2.

• Remove approximately 20 cm of adhesive tape (see figure 3, part number: D 438P11M3). Apply the adhesive tape to the primed surface of the rubber lip/seal and press firmly.



Figure 3.



One roll of double sided tape will do approximately 30 vehicles.

#### Prepare headlamps:

- Thoroughly clean the adhesive surface on the headlamp with isopropanol/water (mixing ratio: 50/50). Allow the adhesive surface to dry well.
- Remove the liner/protective film from the adhesive tape on the rubber lip/seal (see figure 4, red).
- Apply the rubber lip/seal with adhesive tape to the headlamp and press firmly (see figure 5).



After 30 minutes, the final bonding strength of the adhesive tape is about 80%.

Page 3 of 7

© 2023 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Release date: 10/17/2023



Figure 4.

Figure 5

• Reinstall headlamp assembly. See repair manual Group 94 in Elsa.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Release date:

٦

## Warranty

and Procedures M	anual <sup>1)</sup>		1				
Model(s)	Year(s)		Eng. Code(s)	Trans. Code(s)	VIN R Fro	ange om	VIN Range To
Golf R, GTI	2022 - 2024		All	All		.11	All
			SAGA C	oding			
Claim Type:			I	Use applicable C	laim Typ	e <sup>1)</sup>	
Service Number:			Damage Code	нѕт		Damage Location (Depends on Service No.)	
9415		0018			001 = Left 002 = Right		
Parts Manufacturer Golf F			Golf R,	R, GTI WG8		<del>3</del> 8	
			If one headlam	p is affected:			
Labor Operation <sup>3)</sup> : Headlight assembly remove+Install			mbly	94151950 = 20 TU			
Labor Operation <sup>3)</sup> : Radiator grill remove+install			move+install	66051900 = 20 TU			
Labor Operation <sup>3) :</sup> Front bumper cover remove+install				63295040 = 40 TU			
Labor Operation <sup>3) :</sup> Repair headlight			t	94154199 = 20 TU			
Labor Operation <sup>3)</sup> : Headlight assembly adjusted			mbly adjusted	94151650 = 20 TU			
			If both headlamp	s are affected:			
Labor Operation <sup>3)</sup> : Headlight assemblies remove+Install			94152050 = 40 TU				
Labor Operation <sup>3)</sup> : Radiator grill remove+install			66051900 = 20 T	U			

Page 5 of 7

© 2023 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



94-23-01 - Headlamp: Rubber lip-seal (between headlight and 10/17/2023 Release date: fender) loose

Labor Operation <sup>3) :</sup> Front bumper remove+install	cover	63295040 = 40 TU					
Labor Operation <sup>3) :</sup> Repair both h	eadlights	94154299 = 30 TU					
Labor Operation 3): Headlight ass	embly adjusted	94151650 = 20 TU					
Causal Part: Select labor operat	tion	9415****					
	Diagnostic Time <sup>4)</sup>						
GFF Time expenditure	01500000 = Actual GFF print out		Yes				
Road Test	01210002 = 00 TU 01210004 = 00 TU		NO				
Technical Diagnosis	01320000 = 00 TU max.		NO				
Claim Comment: Input "As per Technical Bulletin 2069487" in comment section of Warranty Claim.							
<ul> <li><sup>1)</sup> Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only.</li> <li><sup>2)</sup> Code per warranty vendor code policy.</li> <li><sup>3)</sup> Labor Time Units (TUs) are subject to change with ELSA updates.</li> </ul>							

<sup>4)</sup> Documentation required per Warranty Policies and Procedures Manual.

## **Required Parts and Tools**

Part No:	Part Description	Quantity	
D 438P11M3	Adhesive tape	.033	
D 009 500 25	Sponge brush	1	
D 181220A1	Adhesion promoter/Plastic primer	.033	
D009-40-104	91%+ Isopropyl alcohol	.033	
Part numbers are accurate a information.	t time of publication. Always refer to ETKA for the	e latest part	

© 2023 Volkswagen Group of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



94-23-01 - Headlamp: Rubber lip-seal (between headlight and Release date: 10/17/2023 fender) loose

## **Additional Information**

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.

 $\ensuremath{\textcircled{\text{c}}}$  2023 Volkswagen Group of America, Inc.

Page 7 of 7

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.