



Service Bulletin

Bulletin No.: 16-NA-334

Date: October, 2023

TECHNICAL

Subject: Water Leak/Drips at Left or Right Side of Windshield Header/A-Pillar Area

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Camaro Convertible	2016	2024	—	—	All	All

Involved Region or Country	North America, Europe, Russia, Middle East, Israel, Argentina, Brazil, Bolivia, Chile, Colombia, Paraguay, Peru, Uruguay, Japan, China
Condition	Some customers may comment on water dripping at the left or right side of the windshield header/A-pillar area of the convertible top.
Cause	The cause of the condition may be due to a gap between the weatherstrip and the stop on the windshield header.

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.


Correction

Verify the condition and reposition the front weatherstrip on the affected side by following the steps in the Service Procedure below.

Service Procedure

Note: Adjustment of the front weatherstrip should only be required on the affected side. Adjustment of both sides should not be necessary.

1. Fully open the folding top.
2. Loosen the four outboard front weatherstrip retainer screws on the affected side.

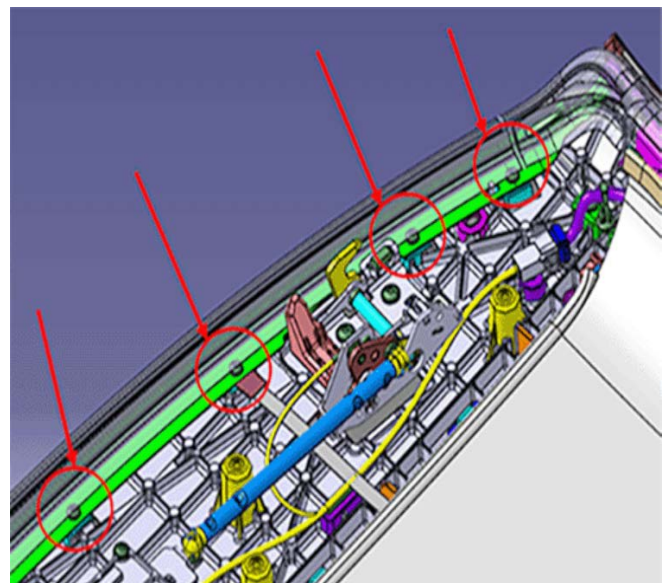

4588938



4588939

3. Pull the weatherstrip, stretching it to gain some additional length in the corner.



4588943

4. Refit the corner until it lines up with the stitch line of the top cover fabric.
5. Retighten the four screws to hold the weatherstrip in place.

Tighten

Tighten the screws to 9 N•m (80 lb in).

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
0580228*	Folding Top Front Weatherstrip Corner Adjustment	0.3 hr

*This is a unique Labor Operation for bulletin use only.

Version	4
Modified	Released October 03, 2016 Revised October 09, 2020 – Added 2018-2021 Model Years, updated the Involved Region or Country section and updated the Warranty coverage statement. Revised July 30, 2021 – Added the 2022 Model Year and removed unnecessary folding top number 1 bow garnish molding removal step. Revised October 11, 2023 - added 2023-2024 Model Years and Important Statement.

