



STAR ONLINE PUBLICATION




Case Number: S2308000118

Release Date: September 2023

Symptom/Vehicle Issue: Malfunction Indicator Lamp (MIL) on, P0052, P0152, O2 Sensor High, P0113 Intake Air Sensor (IAT)

Technician Observation: The technician observed the Power Train Control Module (PCM) has set one or more of the following Diagnostic Trouble Codes (DTCs) as stored or active P0052 - O2 2/1 Heater Sensor Circuit High, P0152 – O2 Sensor 2/1 High, P0113 Intake Air Temperature Sensor 1 Circuit High.

Discussion: Inspect the inline connector XY237A Black 16-way for the involved circuits K199 or K21, look for pushed-out or spread terminals. Secure and or replace the involved circuit terminals as needed. Repair Kit Part Number: 68018957AA.

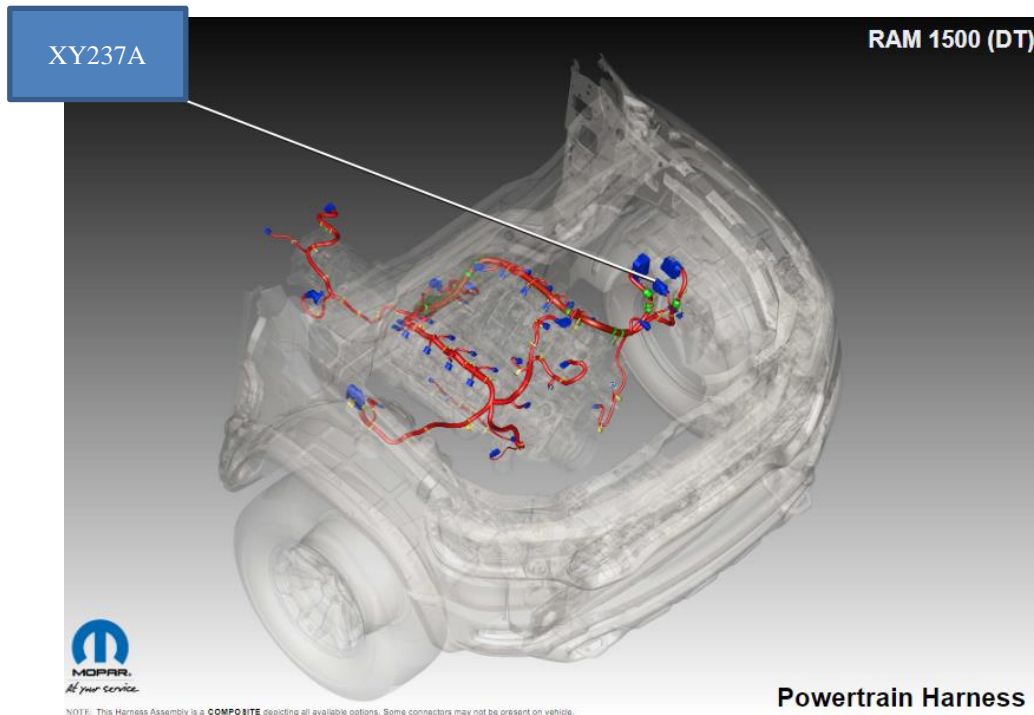

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found