

Technical Service Bulletin

01 PSS 3.0TFSI engine misfires - A6 and A7 - DTCs P0300 through P0306

01 23 85 2058038/5 October 16, 2023. Supersedes Technical Service Bulletin Group 01 number 23-36 dated January 10, 2023, for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6, A6 allroad, and A7	2021	All	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
5	-	Revised header (Removed MY) Revised <i>Production Solution</i> (Updated estimate)
4	01/11/2023	Revised header (Removed MY) Revised <i>Production Solution</i> (Updated estimate)
3	04/07/2021	Revised header (Added MY) Revised <i>Production Solution</i> (Updated estimate)

This bulletin applies to MY20 A6 & A7 3.0 vehicles only.

Customer States:

MIL may be illuminated.


Workshop findings:

The following DTCs may be stored:

- **DTC P0300:** Random/Multiple Cylinder Misfire Detected
- **DTC P0301:** Cyl.1 Misfire Detected
- **DTC P0302:** Cyl.2 Misfire Detected
- **DTC P0303:** Cyl.3 Misfire Detected
- **DTC P0304:** Cyl.4 Misfire Detected
- **DTC P0305:** Cyl.5 Misfire Detected
- **DTC P0306:** Cyl.6 Misfire Detected

Technical Background

Software calibration causes a misfire under certain running conditions using winter blend fuel (higher vapor pressure). This condition would occur mostly during winter months.

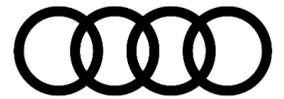

Technical Service Bulletin

Production Solution

Improved software in development.

Service

1. If the customer's vehicle condition matches the condition listed in the *Technical Background* of this PSS, explain to the customer that a solution is expected to be available by the end of the 4th quarter of 2023 (subject to change) and that no repairs are necessary at this point
2. Do not replace any components for this condition since this will not resolve the customer's concern.
3. Create a PSS record in the PSS application through the Pending Service Solutions (PSS) link in AccessAudi (under *Related Links* >> *Service*).

Please refer to TSB 2069038 for Model Year 2019 and 2021 A6/A7 vehicles.

Warranty

This TSB is informational only and not applicable to any Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2058038**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.