

# **Technical Service Bulletin**

**01 Vehicle start system warning is displayed in cluster, DTC(s) P086D00, P086E00 stored in the ECM** 01 23 88 2071791/1 October 24, 2023.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q3	2019 – 2020	All	Not Applicable
A3, S3, and RS 3	2022 – 2023		Not Applicable

### **Condition**

#### **Customer statement:**

• The message "Vehicle start system: fault. Please contact workshop" appears in the instrument cluster.

#### Workshop findings:

One or more of the following DTCs are stored in the engine control unit J623 (diagnostic address 0001) either as static or intermittent:

- DTC P086D00: Neutral Position Sensor "A" Circuit High
- DTC P086E00: Neutral Position Sensor "A" Circuit Intermittent/Erratic

### **Technical Background**

On vehicles manufactured within a specific period, the supply line to the gearbox neutral position sender G701 may be too short.

#### **Production Solution**

The length of the harness has been increased in production.

### **Service**

Check the wiring at the gearbox neutral position sender G701 (Figure 1).

If one of the wires is damaged, repair all 3 wires using wire repair set VAS 1978 B.



# **Technical Service Bulletin**



Figure 1: G701 Wire damage.



Lengthen the 3 wires by 20 mm so that the problem cannot reoccur.

## Warranty

Claim Type: Service Number:	<ul> <li>110 Up to 48 Months/50,000 Miles.</li> <li>G10 for CPO Covered Vehicles – Verify Owner.</li> <li>If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only.</li> </ul>		
Damage Code:	0029	1	
Labor Operations:	Remove and install noise insulation	1082 1900	See SRT with associated operations
	Repair central wiring harness	9709 41xx	See SRT with associated operations
Diagnostic Time:	GFF	0150 0000	Time stated on the diagnostic protocol (Max 50 TU)
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB 2071791/1		



# **Technical Service Bulletin**

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

### **Required Parts and Tools**

The part numbers mentioned in this TSB are different than the ones listed in ETKA. Only use parts listed
in this TSB, this includes superseding part numbers!

Part Number	Part Description	Quantity	
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA	
000979034EA	Individual wire	2	
000979940	Butt connector	3	
3C0972741	Wiring seal	3	

Tool Number	Tool Description
VAS 1978 B	Wire harness repair set

### **Additional Information**

All parts and service references provided in this TSB (2071791) are subject to change and/or removal.

©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.