



01-20-02TT - DTCs P0201, P0202, P0203, P0204

Release date: 10/19/2023

Condition

ATTENTION:

**THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.
TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.**

Applicable Vehicles

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Passat	2018-2020	2.0L (DDSA,DDSB)	All	All	All
Beetle, Beetle Convertible, Tiguan LWB	2018-2019	2.0L (DDSA, DGUA)	All	All	All

Revision Table

Instance Number	Published Date	Version Number	Reason For Update
2058719/3	10/19/2023	01-20-02TT	Addition of MY 2018-2020 Passat
2058719/1	2/21/2020	01-20-02TT	Original publication.

Technical Background

Injector circuit faults, which may present intermittently, in the -**J623**- Engine/Motor Control Module.

DTC	Description
P0201	Cylinder 1-Injector Circuit
P0202	Cylinder 2-Injector Circuit
P0203	Cylinder 3-Injector Circuit
P0204	Cylinder 4-Injector Circuit

Service

If the above DTC's are present in the ECM, inspect the injector wiring harness part number:

- If part # 06L 971 627 AB is not installed, replace the T8 fuel injector harness.
- If part # 06L 971 627 AB is already installed, TT does not apply, continue with diagnosis.



01-20-02TT - DTCs P0201, P0202, P0203, P0204

Release date: 10/19/2023

Additional Information

© 2023 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.