

<b>Subject:</b>  FRONT WINDOW DOES NOT AUTO CLOSE	<b>Service Alert No.:</b> SA-066/23
	<b>Last Issued :</b> 10/19/2023

## BULLETIN NOTES

### APPLICABLE MODEL(S)/VINS

2024 CX-90

## DESCRIPTION

Some customers will report their window will not auto-close. This may be caused by the vehicle learning the window current draw incorrectly because the door moved when the initialization was performed.

## REPAIR PROCEDURE

1. Verify the customer concern.
2. Perform the **POWER WINDOW SYSTEM INITIALIZATION PROCEDURE** with the door closed.

**NOTE: DO NOT perform the procedure with the door unlatched or it may move during the initialization and learn the normal current draw incorrectly.**

3. Open and close the window using the auto function 5 times.

### Did it work correctly?

- **YES** - Return the vehicle to the customer.
- **NO** - Diagnose using the instructions in MGSS.

**CONSUMER NOTICE:** The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/ equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.