COOLING FAN INOPERABLE / MALEUNCTION - P4

Customer Voice:

• Cooling fan may intermittently fail to operate, causing a potential engine-overheat condition and/or AC not to function.

Technical Description:

• Diagnostic Trouble Code (DTC) P0480-13 will be stored in the Powertrain Control Module (PCM).

Status:

- A new cooling fan.(LR164713) should be ordered through parts catalogue.
- Make sure the part number label has '#ST3' printed on it, this will confirm that the part is at the latest level and will rectify the customer concern.
- If the required part is on back-order, to prevent the above symptoms from becoming present, advise the customer that the ignition must be switched ON within 15 seconds of the driver's door being unlocked and opened.
- If the above symptoms are already present, then the below steps must be completed in order to temporarily rectify the concern:
 - 1. Turn the engine and ignition OFF
 - 2. Lock the vehicle.
 - 3. Wait for a minimum of 7 minutes.
 - 4. Unlock the vehicle, open the driver's door and turn the ignition ON within 15 seconds

Refer to SSM 76075

Defender23MY Defender

Discovery23MY Discovery

