



## **SSM 52015 2023 F-Super Duty - Illuminated Brake Warning Indicator - DTCs C0047 And/Or P0557 - Built On Or Before 01-Aug-2023**

Some 2023 F-Super Duty vehicles equipped with vacuum assist brakes and built on or before 01-Aug-2023 may exhibit an illuminated brake warning indicator with diagnostic trouble codes (DTC) C0047 and/or P0557 present. This may be due to the brake vacuum sensor. To correct the condition, remove and replace the brake vacuum sensor, part NK4Z-2C444-A. To prevent repeat concerns, install the sensor with the electrical connector pointed towards the identification label on the vacuum brake booster.