



Technical Service Bulletin

01 MIL on - DTC P060C00 is stored in the ECM

01 23 93 2068506/2 November 16, 2023. Supersedes Technical Service Bulletin Group 01 number 22-30 dated December 5, 2022 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
RS Q8	2020 – 2021	All	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised header (Added MY 2021 RS Q8) Revised <i>Service</i> (Updated statement, included software information for MY 2021) Revised <i>Warranty</i> (Updated Labor Operations) Revised <i>Additional information</i> (Updated referenced bulletins)
1	12/05/2022	Initial publication

Customer states:

- The MIL is illuminated.

Workshop findings:

The following DTC may be stored in the engine control module ECM, J623 (address word):

- DTC P060C00** (Internal Control Module Main Processor Performance) with **symptom code 30924**.

Technical Background

This is a rare occurrence and is caused by the sensitivity of diagnostics software in the ECM, J623 (address word 0001).

Production Solution

New software in the ECM, J623 (address word 0001) addressed the condition.

Service

This TSB replaces Pending Service Solution (PSS) TSB 2069881: *PSS 01 MIL/ EPC light on DTC P060C00 is stored in ECM.*

Please refer to (PSS) TSB 2069882: *01 DTC P060C00 is stored in the ECM for MY22 RS Q8 vehicles.*



Technical Service Bulletin

SVM Update Instructions

1. Follow all instructions in TSB 2011732: 00 Software Version Management (SVM), operating instructions.
2. Update the ECM, J623 (address word 0001) using the SVM action code as listed in the table below, if necessary:

Model	Old Software Part Number	Old Software Version	New Software Part Number (or higher)	New Software Version (or higher)	SVM Code Input
RSQ8	4M8907557B	0003	4M8907557B	0004	01A282
RSQ8	4M8907557F	0001	4M8907557F	0002	01A255

Warranty

Claim Type:	<ul style="list-style-type: none"> • 110 up to 48 Months/50,000 Miles. • G10 for CPO Covered Vehicles – Verify Owner. • If the vehicle is outside any warranty, this Technical Service Bulletin is informational only. 		
Service Number:	2470		
Damage Code:	0039		
Labor Operations:	Software Update (Includes checking for DTCs)	0151 0000	Time stated on the diagnostic protocol (Max 50 TU)
Diagnostic Time:	GFF	0150 0000	Max 15 TU
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB 2068506/2		

All warranty claims submitted for payment must be in accordance with the Audi Warranty Policies and Procedures Manual. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Tool Number	Tool Description
VAS 6160/VAS 6150	VAS tester with the current version of ODIS (Windows 10)



Technical Service Bulletin

Additional Information

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

- TSB 2011732: *00 Software Version Management (SVM), operating instructions.*

All part and service references provided in this TSB (**2068506**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.