

69 Airbag warning light on, difficult to activate horn, B120E11, B100011 69 23 03 2072076/1 November 17, 2023.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A3, S3, and RS 3	2022 – 2024	All	Not Applicable

Condition

Customer states:

- The airbag warning light is on.
- It is difficult to activate the horn at the six o'clock position.

Workshop findings:

One of the following DTCs are stored in the airbag control module, -J234- (address word 0015):

- DTC B120E11: driver airbag release valve igniter Short circuit to Ground (GND)
- DTC B100011: driver airbag igniter Short circuit to Ground (GND)

Technical Background

Incorrect routing of the driver airbag wire harness.

Production Solution

Improved routing of the airbag wire harness.

Service

- 1. Remove the driver airbag according to: Elsa>>Repair manual>>Body>>Body Interior>>69 Passenger Protection, Airbags, Seat belts>>Driver Side Airbag>>Airbag Unit with igniter, Removing and Installing.
- 2. Inspect the routing of the driver airbag wire harness. Pay close attention to the wire routing in the following two areas (Figures 1-5).

Round airbag:



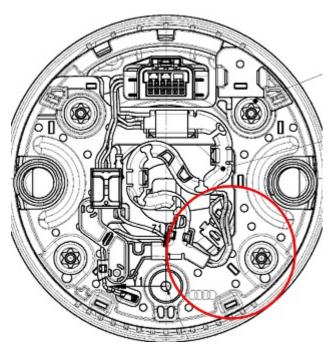


Figure 1. Inspect wire harness for damage and routing in the circled area.

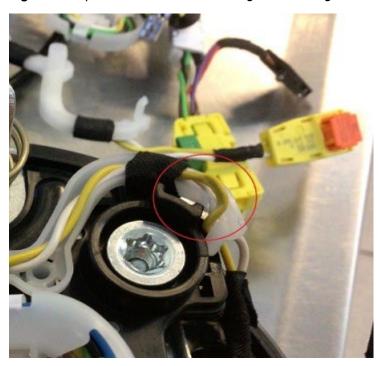


Figure 2. Damaged wire harness.



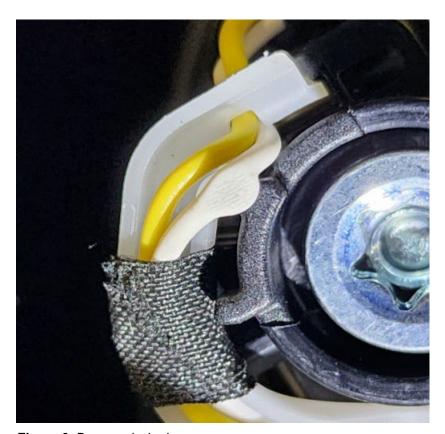


Figure 3. Damaged wire harness.

Square airbag:

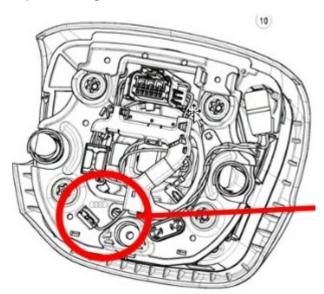


Figure 4. Inspect wire harness for damage and routing in the circled area.





Figure 5. Check airbag wire harness for damage and routing.

- 3. Replace the driver airbag wire harness and observe the cable routing when reinstalling the driver airbag.
- 4. After reinstalling the driver airbag, clear all fault codes.

Warranty

Claim Type:	 110 Up to 48 Months/50,000 Miles. G10 for CPO Covered Vehicles – Verify Owner. If the vehicle is outside of any warranty, this Technical Service Bulletin is informational only. 		
Service Number:	9766		
Damage Code:	0024		
Labor Operations:	Driver airbag unit remove+reinstall	6958 1900	See SRT with associated operations
	Driver airbag harness replace	9766 5599	10 TU



Diagnostic Time:	GFF	0150 0060	Time stated on the diagnostic protocol (Max 30 TU)
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB 2072076/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Always check with your Parts Department and/or ETKA for the latest information and parts bulletins.		
Part Number	Part Description Quantity	
See ETKA	Fasteners, Bolts, Nuts, and Screws as needed per the Repair Manual	See ETKA/ELSA
8Y0971589	Airbag harness	01
or		
83A971589B	Airbag harness	01

Tool Number	Tool Description
VAS 6160/VAS 6150	VAS tester with the current version of ODIS (Windows 10)

Additional Information

All parts and service references provided in this TSB (2072076) are subject to change and/or removal.

©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.