



Preliminary Information

PIT6072 Service Power Steering Message, No Crank / Start, Infotainment Issues, Door Locks Cycle, Multiple DTCs Possible

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Colorado	2023	All	All	All	All
GMC	Canyon	2023	All	All	All	All

Involved Region or Country:	North America
Condition:	Service power steering message, infotainment issues, power loss, no start, no crank, door locks cycling, multiple communication or invalid data dtcs,
Cause:	Poor connection at G201B.

Inspect G201B. Verify that it is tight but you may find the heat shrink on the eyelet migrated and glue is interfering with the contact with the frame. Clean painted frame surface, remove excess heat shrink sleeve and glue from eyelet surface and re secure and retest. See example below.



Version History

Version	1
Modified	10/05/2023 - Created on.



GENERAL MOTORS