



Preliminary Information

PIC6524 Instrument Panel Will No Longer Change Themes When Various Drive Modes Are Selected After OTA Update

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Corvette	2023	All	All	All	All

Involved Region or Country	North America
----------------------------	---------------

Some customers may comment that after an Over The Air (OTA) update was performed on 9/7/23 or later, the theme or layout of the IPC no longer changes when the driver changes the Drive Mode using the rotary knob on the center console. It is important to note that the Drive Mode can still be changed with this issue. To confirm, start the vehicle and monitor the icon in the IPC as shown in the photograph below. Verify that the icon will change to the corresponding Drive Modes (Weather, Tour, Sport, Track, and My Mode) as the driver rotates the knob.



Concern This concern was caused by a software anomaly within the OTA update.

Correction:

To correct this issue, simply scroll through the DIC's Personalization menu and reselect the "Link To Drive Mode" option, as seen in the photo below. No further programming is needed to resolve this concern.



If a customer calls the dealership with this issue, he or she can easily complete this selection without the need to bring the vehicle into the dealer for service. Please refer to the Owner's Manual section titled "Display Themes" which can be found on page 81.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
3487978	Reset IPC Display Design Personalization Setting (Labor Only)	0.1 Hr.

Version History

Version	1
Modified	10/09/2023 - Created on.

