



Preliminary Information

PIT5636D SES MIL DTC P1005

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 1500 (New Model)	2019	All	All	All	All
Chevrolet	Silverado	2020	All	All	All	All
GMC	Sierra 1500 (New Model)	2019	All	All	All	All
GMC	Sierra	2020	All	All	All	All

Involved Region or Country	North America
Condition	Some customers may comment on a SES MIL. When the vehicle is checked for DTCs, a P1005 will be set in the ECM.
Cause	Software error in the fuel pump driver control module.

Correction:

GM Engineering has released a new updated fuel pump driver control module to correct this concern. Replace the fuel pump driver control module with updated part number listed in the parts information section below.

Parts Information

Part Number	Description	Qty
13540028	Fuel Pump Driver Control Module - Engines: LV3, L3B, L82, L84, L87, L8T	1
13540026	Fuel Pump Driver Control Module - Engines: LM2, L5P	1

Warranty Information

For vehicles repaired under the Emission coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Note: Warranty Coverage Codes E and E2 apply to Labor Operation 4087298.

Labor Operation	Description	Labor Time
*4087298	Replace Fuel Pump Driver Control Module	0.5 Hr.

*This is a unique Labor Operation for bulletin use only.

Version History

Version	5
Modified	<p>10/12/2018 - Created on</p> <p>01/17/2020 - Updated the Models, Cause, Correction, Warranty and Parts sections.</p> <p>02/05/2020 - Updated to correct the labor operation.</p> <p>03/21/2023 - Update to the Warranty Section</p> <p>10/17/2023 - Updates to the Warranty and Parts sections</p>



GENERAL MOTORS

© 2023 General Motors. All Rights Reserved.