



# Preliminary Information

## PIP5950 L8T – MKM Setting P060C P060D

### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 2500HD/3500HD	2024	All	ALL	L8T	MKM
GMC	Sierra 2500HD/3500HD	2024	ALL	ALL	L8T	MKM

<b>Involved Region or Country</b>	<b>Asia/Pacific, Australia, Europe, Israel, North America, Middle East Operations, &amp; Palestine</b>
<b>Condition</b>	DTC P060C and/or P060D setting in the TCM after/during an attempted Service Fast Learn.
<b>Cause</b>	TCM software anomaly.

### Correction :

Clear the DTC.

Do not replace the TCM

Do not attempt the SFL.

Complete the "Transmission Adaptive Pressure Reset" procedure in GDS2.

If the trans is operating as designed with no DTCs setting, return the vehicle to the customer.

**\*\* Note \*\* This concern is being investigated, P/I will be deleted or update into a TSB as needed.**

### Version History

Version	<b>1</b>
Modified	11/14/2023 - Created on.



GENERAL MOTORS