



# Preliminary Information

## PIT6089 Center High Mounted Stop Lamp Inoperative or Flickers

Product Investigation Review Required

### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Blazer EV	2024	All	All	All	All

Involved Region or Country	North America
Condition	A vehicle may be encountered with a center high mounted stop lamp (CHMSL) that is inoperative or flickering. The concern may be constant or intermittent.
Cause	Loose connection at the CHMSL

### Correction:

- Do Not Replace the Center High Mounted Stop Lamp.
- Remove the rear spoiler to gain access to the CHMSL connector.
- Remove the connector and reinstall it with adequate force to ensure it is fully seated.
- With the aid of an assistant to press the brake pedal, wiggle the connector and ensure the light does not flicker or go out.
- Reinstall the rear spoiler.

### Version History

Version	1
Modified	11/21/2023 - Created on.

