



Preliminary Information

PIT5964A 2022 HUMMER EV Exterior Lamps Flicker Every 8 seconds Along With A Momentary Pause Of The Windshield Wipers And Turn Signal Click Clack Sound Effect With Current Or History DTC: P0607

Proactive

Models

| Brand: | Model: | Model Years: | VIN: | | Engine: | Transmissions: |
|--------|-----------|--------------|------|-----|---------|----------------|
| | | | from | to | | |
| GMC | HUMMER EV | 2022 | All | All | All | All |

| | |
|----------------------------|--|
| Involved Region or Country | North America |
| Condition | Some customers may experience one or more of the following concerns: <ol style="list-style-type: none"> 1. Exterior Lamps Flicker every 8 seconds 2. Momentary pause of the windshield wipers 3. Momentary pause of the turn signal indicator clicking sound effect 4. Current or history code: P0607 |
| Cause | The cause of this concern could be a K219 Lighting control module that is in boot mode (Logic Locked) |

Correction:

Reprogram the K219 Lighting control module to the latest software released in SPS.

Warranty Information

For vehicles repaired under the warranty, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

| Labor operation | Description | Labor Time |
|-----------------|--|--------------------|
| 2811105 | K219 Lighting Control Module Reprogramming with SPS. | Use Published Time |

Version History

| | |
|----------|---|
| Version | 2 |
| Modified | 01/04/2023 - Created on. 11/21/2023- Updated the correction. |



GENERAL MOTORS

© 2023 General Motors. All Rights Reserved.