



Preliminary Information

PIT6093 Drivers Window Does Not Fully Close

Models

| Brand: | Model: | Model Years: | VIN: | | Engine: | Transmissions: |
|-----------|-----------|--------------|------|-----|---------|----------------|
| | | | from | to | | |
| Chevrolet | Blazer EV | 2024 | All | All | All | All |

| | |
|----------------------------|--|
| Involved Region or Country | North America |
| Condition | <p>A customer or technician may notice that the driver's window does not fully close, leaving a 4 mm gap at the top.</p> <p>A customer may complain of a wind noise from the driver's window.</p> <p>This condition may be intermittent.</p> <p>It may be found that this condition occurs after using the express up feature.</p> <p>It may also be noticed that the window goes up an additional 4 mm, after an auto stop.</p> |
| Cause | Calibrations |

Correction:

If this condition is found do not attempt any repairs.

This is caused by a calibration that provides a "soft stop" on the window during an express up activation.

Please advise the customer to briefly press the window switch in the up position after completing an express up function. This will fully close the window.

Advise the customer that updated calibrations will be made available in the future to address this concern.

Version History

| | |
|----------|--------------------------|
| Version | 1 |
| Modified | 11/29/2023 - Created on. |



GENERAL MOTORS