



# Technical Service Bulletin

---

## 94 PSS Low beam headlight warning in instrument cluster, DTC: C1198F7 stored in D6/D7

94 23 70 2072429/1 December 15, 2023.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q8, and SQ8	2024	All	Laser headlights

## Condition

### Customer states:

After switching on the ignition, or when the vehicle is started, the message “*left or right low beam headlight defective. See owner’s manual*” appears in the instrument cluster although the headlights are fully functional.

### Workshop findings:

The customer concern can be reproduced.

The following DTC is stored in the left/right lamp control module A31/A27 (address word 00D6/00D7):

- **DTC C1198F7** Low beam light bulb output power implausible / symptom 1890.

## Technical Background

Diagnostic software too sensitive in the light control modules.

## Production Solution

New software in production.

## Service

1. Explain to the customer that a solution is expected to be available by the end of the 1st quarter of 2024 (subject to change) and that no repairs are necessary at this point. Do not replace any components for this condition since this will not resolve the customer’s concern.
2. Create a PSS record in the PSS application through the Pending Service Solutions (PSS) link in AccessAudi (under *Related Links >> Service*).

### Workaround:

The fault message in the instrument cluster can be avoided by changing the **light signature to signature #1**.

## Warranty

This TSB is informational only and not applicable to any Audi Warranty.



# Technical Service Bulletin

---

## Additional Information

All part and service references provided in this TSB (**2072429**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2023 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.