

**01-23-11 - Update Programming DTC P052A, P054A, P0300-P0304  
Stored In Engine/Motor Control Module -J623-**

Release date: 12/11/2023

---

**Condition**

Applicable Vehicles					
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Atlas	2020-2021	2.0T (DCGA)	ALL	ALL	ALL
Atlas Cross Sport	2020-2021	2.0T (DCGA)	ALL	ALL	ALL

Revision Table			
Instance Number	Published Date	Version Number	Reason For Update
2071951/1	12/11/23	01-23-11	Original publication.

**NOTICE**

This TSB only applies to MY20 & MY21 Atlas and Atlas Cross Sport vehicles with 2.0T engines.

One or more of the following fault code(s) must be stored in the ECM:

DTC	Description
P052A	Cold Start "A" Camshaft Position Timing Over-Advanced Bank 1
P054A	Cold Start "B" Camshaft Position Timing Over-Advanced Bank 1
P0300	Random/Multiple Cylinder Misfire Detected
P0301	Cyl.1 Misfire Detected
P0302	Cyl.2 Misfire Detected
P0303	Cyl.3 Misfire Detected
P0304	Cyl.4 Misfire Detected



01-23-11 - Update Programming DTC P052A, P054A, P0300-P0304  
Stored In Engine/Motor Control Module -J623-

Release date: 12/11/2023

### NOTICE

DO NOT diagnose or replace any components for the above fault(s) before performing the update function as explained in this bulletin.

## Technical Background

Improvements made to ECM software for better combustion stability during catalyst heating and engine warmup, and changes to misfire detection thresholds for improved misfire recognition during catalyst heating.

### NOTICE

Volkswagen has implemented a 15 year/150,000 mile extended warranty covering a one-time software update in the event these fault codes are stored. See Warranty Policy Bulletin VWP-23-08 for details.

## Production Solution

Improved software implemented into production.

## Service

### Procedure:

- Inspect the software level of the ECM and compare to the software table below. If the software level in the vehicle is current, this TSB does not apply and further diagnosis is needed.
- If the software level is not up-to-date, continue with the software update as listed below.

### NOTICE

Repairs outside the scope of this TSB are not applicable and not covered under this warranty extension. Refer to VWP-23-08 for additional details.



01-23-11 - Update Programming DTC P052A, P054A, P0300-P0304  
Stored In Engine/Motor Control Module -J623-

Release date: 12/11/2023

---

**Update-Programming Procedure:**

 **WARNING**

Critical Warning: The Midtronics battery charger must be connected to the vehicle battery for the duration of the programming, to ensure the battery state of charge remains above 12.5 volts during the update process. If the battery drops below 12.5 volts, the programming could fail which may result in damage to the control module. Control modules damaged by inadequate voltage will not be covered under the warranty policy. The technician should verify the vehicle voltage prior to starting the update process, and should monitor the voltage for the duration of the update.

 **WARNING**

Radiator Fan(s) may cycle ON high speed during the Update Process! There is a risk that personal injury may result if contact is made with spinning fan blades.

- Keep hands and all objects away from Radiator Fan(s) during Update Process!

 **CAUTION**

Prior to launching the ODIS service diagnostic applications and starting control module update process, confirm tester screen saver and power settings in accordance with Special Tools and Equipment - Service Information Circular # VVT-12-02. Failure to do so may result in the tester entering power save mode during data transfer, and subsequent control module failure.

- When using a VAS 6150/X or 6160/X tester in conjunction with a VAS 5054A wireless transmitter head for a flash procedure, connect a USB cable between the transmitter head and the tester. Failure to do so may lead to errors during the flash procedure. VAS tools must only be used with their power adapters plugged in. Under no circumstances should they be used on battery power alone during the programming procedure.



01-23-11 - Update Programming DTC P052A, P054A, P0300-P0304 Stored In Engine/Motor Control Module -J623-

Release date: 12/11/2023

**NOTICE**

To Update-Programming using Software Version Management (SVM), review and follow instructions in Technical Bulletin Instance 2014603 “Software Version Management”.

- The SVM Process must be completed in its entirety so the database receives the update confirmation response. A warranty claim may not be reimbursed if there is no confirmation response to support the claim or action is carried out that is not explicitly stated in the Technical Bulletin.

- Update the -**J623**- Engine/Motor Control Module using the SVM Unit code as listed in the table below:

Model	Engine	Old Software Part No.	Old Software Version	New Software Part No.	New Software Version (or higher)	SVM Unit Code
<b>Atlas</b>						
2020 Atlas	2.0T (DCGA)	3CN 906 259 C	0001	3CN 906 259 C	0002	4548
2021 Atlas	2.0T (DCGA)	3CN 906 259 F	0001	3CN 906 259 F	0002	4548
<b>Atlas Cross Sport</b>						
2020 Atlas Cross Sport	2.0T (DCGA)	3CN 906 259 C	0001	3CN 906 259 C	0002	4548
	2.0T (DCGA)	3CN 906 259 E	0001	3CN 906 259 E	0002	4548
2021 Atlas Cross Sport	2.0T (DCGA)	3CN 906 259 F	0001	3CN 906 259 F	0002	4548



01-23-11 - Update Programming DTC P052A, P054A, P0300-P0304 Stored In Engine/Motor Control Module -J623-

Release date: 12/11/2023

**NOTICE**

The procedure can be found in GFF under Functions/ Component Selection, Software Version Management, Adapting Software.

- Ensure attached ECM/TCM Tuning Form has been completed and signed by customer as required in SVM Technical Bulletin Instance 2014603.

- Perform a road test of the vehicle. If faults return, further diagnosis is needed and is not covered under this TSB.

### Warranty

<b>To determine if this procedure is covered under Warranty, always refer to the Warranty Policies and Procedures Manual 1)</b>					
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Atlas	2020 - 2021	2.0T (DCGA)	ALL	ALL	ALL
Atlas Cross Sport	2020 - 2021	2.0T (DCGA)	ALL	ALL	ALL
<b>SAGA Coding</b>					
<b>Claim Type:</b>		<b>Use applicable Claim Type 1)</b>			
<b>Service Number:</b>	<b>Damage Code</b>	<b>HST</b>	--		
2470	0039	--	--		
<b>Parts Manufacturer</b>	Atlas Atlas Cross Sport		WWO 2)		
<b>Labor Operation 3) : Charge Battery</b>			01500010 = See Elsa for latest time units.		
<b>Labor Operation 3) : Update Programming</b>			See GFF Time expenditure		
<b>Causal Part: Select Labor Operation</b>			01500060		



01-23-11 - Update Programming DTC P052A, P054A, P0300-P0304  
Stored In Engine/Motor Control Module -J623-

Release date: 12/11/2023

Diagnostic Time 4)		
GFF Time expenditure	01500060 = 50 TU max.	YES
Road Test	01210004 = 10 TU	YES
Technical Diagnosis	01320000 = 00 TU max.	NO
Claim Comment: Input "As per Technical Bulletin "2071951" in comment section of Warranty Claim.		
1) Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only 2) Code per warranty vendor code policy. 3) Labor Time Units (TUs) are subject to change with ELSA updates. 4) Documentation required per Warranty Policies and Procedures Manual.		

### Required Parts and Tools

No special parts required.

Tool Description	Tool No.
Midtronics Battery Tester/Charger	GRX3000VAS or MTRMSP0702 battery maintainer/charger
VAS Diagnostic Tool	VAS 6150/X & VAS 6160/X with: ODIS Service with current online updates.

### Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.



**OWNER INFORMATION ABOUT CONTROL MODULE TUNING\*  
ACKNOWLEDGEMENT AND AUTHORIZATION FOR  
REPROGRAMMING (REFLASHING) OF CONTROL MODULE(S)**

 
\*) "TUNING" is described as the addition of or modification of any component which causes a Volkswagen vehicle to perform outside the normal parameters and specifications approved by Volkswagen Group of America / Volkswagen Group Canada.

Date: \_\_\_\_\_

Dealer Number: \_\_\_\_\_

Vehicle Identification Number: \_\_\_\_\_

Repair Order Number: \_\_\_\_\_



Dealer stamp

I \_\_\_\_\_, owner or driver of the above identified Volkswagen, confirm:

"Tuning" as described above (especially power increasing modifications) has NOT been performed on my vehicle.

"Tuning" as described above has been performed on my vehicle and the following components were modified or installed:

\_\_\_\_\_  
 \_\_\_\_\_  
 TUNING was performed by (Please provide Company name and telephone number, if you wish us to contact them):  
 \_\_\_\_\_  
 \_\_\_\_\_

I understand that if my Control Module is determined to have been tuned, any damage caused by the tuning of the Control Module (including adverse emissions consequences) will not be covered by VWGoA / VGC warranties.

I am permitting an authorized Volkswagen Dealer to reflash (update) my Control Module, and by doing so, I understand that this process will automatically overwrite (destroy) and permanently delete any tuning program that was previously installed on the Control Module of my Volkswagen vehicle.

By signing below, I fully acknowledge and understand that the tuning program will not be restored and VWGoA / VGC, will not be liable in any way for the loss of tuning data.

\_\_\_\_\_  
 Signature of Customer