

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



MASTERS OF CARE

Rapid Update 674 Grecale – BCM Software Update



ATTENTION! This document replaces MAS003801 RU 23-56. Please discard any paper copy of the previous bulletin

DATE: NOVEMBER 14 2023

Certain Maserati Grecale (M182) MY23 MY24 listed in MODISCS+ are involved in a Rapid Update to update the Body Control Module (BCM) software.

A software update is necessary to correct a potential issue with the wireless charger that can cause interference during the key fob search process. As a result, in very rare instances, the message "Key fob left the vehicle" may appear on the cluster display.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before ordering parts and/or starting the procedure.

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions. (Maseratitechsupport@maserati.com)

Thank You for your continued support and cooperation.

Maserati Americas
Aftersales Dept.

Technical Procedure

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Before proceeding, please ensure that the Engine is OFF.
3. Connect a battery maintainer to the 12V battery (It is recommended to always use the E-XTEQ MAXIMUS to maintain minimum voltage and current draw requirements)
4. Connect the EVO to the vehicle, ensure that battery voltage is around 12.5V then select **BCM ► ECU Programming** and follow the prompts.

IMPORTANT! Please carefully follow the instructions/prompts given during this process.
(Example: request to switch the **ignition OFF**)

5. Procedure complete.

Software version to be installed.

Module	F188 New
BCM	670309694

Make sure the BCM SW update was successfully performed by checking the SW version via "base diagnosis".

About the new SW: In comparison, the new software version, **SW 18.2 (F188 670309694)** vs. the old **SW 18.1 (F188 670308226 - MAS003801 RU 23-56)** is **technically the same**. This change is due to a kind of **F188** unification between several types of HW. In other words, just the software naming changed, no functional changes.

If the vehicle involved has already been updated to SW 18.1, there is no need to upgrade to the 18.2 version.

Warranty Claim

Fill in the relative Warranty Claims as follows:

Description	Code
Rapid Update Number	674
Warranty Code	23
Fault Code	063
Component Code	8.61.035
Operation Code	8.61.035.C (0,20 h)