

MAS003690 RU 23-77

**RAPID UPDATE**

FROM: Maserati TSO

TO: Maserati Network



**Maserati**

PERSONAL SERVICE LAB

MASTERS OF CARE

TECHNICAL SERVICE OPERATIONS

# Rapid Update 690 GranTurismo – BCM Software Update



DATE: NOVEMBER 30 2023

Certain Maserati GranTurismo (M189) MY24 listed in MODISCS+ are involved in a Rapid Update to update the Body Control Module (BCM) software.

A software update is necessary to correct a potential issue with the wireless charger that can cause interference during the key fob search process. As a result, in very rare instances, the message "Key fob left the vehicle" may appear on the cluster display.

We remind you that all Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

**Please read and review this bulletin first before ordering parts and/or starting the procedure.**

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions.

Thank You for your continued support and cooperation.

Maserati Americas  
Aftersales Dept.

## Technical Procedure



All images shown in this bulletin are for illustrative purposes only

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Before proceeding, please ensure that the Engine is OFF.
3. Connect a battery maintainer to the 12V battery (It is recommended to always use the E-XTEQ MAXIMUS to maintain minimum voltage and current draw requirements)
4. Connect the EVO to the vehicle, ensure that battery voltage is around 12.5V then select **BCM ► ECU Programming** and follow the prompts.

**IMPORTANT!** Please carefully follow the instructions given during this process. (Example: request to switch the **ignition OFF**)

5. Procedure complete.

Software version to be installed.

ECU	F188 New
BCM	670309694

ROW = Rest Of World

Make sure BCM SW update was successfully performed by checking the SW version via "base diagnosis".

## Warranty Claim

Fill in the relative Warranty Claims as follows:

Description	Code
Rapid Update Number	690
Warranty Code	23
Error Code	063
Component Code	8.61.035
Operation Code	8.61.035.A (0,20 h)