

MAS003853 RU 23-65

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



PERSONAL SERVICE LAB

MASTERS OF CARE

Rapid Update 676 GranTurismo – IPC Software Update



DATE: NOVEMBER 3 2023

Certain Maserati GranTurismo (M189) MY24 listed in MODISCS+ are involved in a Rapid Update to update the Instrument Panel Cluster (IPC) software.

This update is essential to resolve a potential issue in which, under specific conditions, the vehicle's display may remain black when the key is turned on while the LED indicators continue to function correctly. However, cycling the key from OFF to ON resolves this issue.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before ordering parts and/or starting the procedure.

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions. (MaseratiTechsupport@maserati.com)

Thank You for your continued support and cooperation.

Maserati Americas
Aftersales Dept.

Technical Procedure

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Before proceeding, please ensure that the Engine is OFF.
3. Connect a battery maintainer to the 12V battery (It is recommended to always use the E-XTEQ MAXIMUS to maintain minimum voltage and current draw requirements)
4. Connect the EVO to the vehicle, ensure that battery voltage is around 12.5V then select **IPC**
 ► **ECU Programming** and follow the prompts.
5. Procedure complete.

Software version to be installed (or newer).

Module	F188 Target
IPC	670305850

Warranty Claim

Fill in the relative Warranty Claims as follows:

Description	Code
Rapid Update Number	676
Warranty Code	23
Fault Code	063
Component Code	8.50.001
Operation Code	8.50.001.A (0,20 h)