

WPS3 Workshop Campaign - Replacing high voltage converter

WPS3 Workshop Campaign - Replacing high voltage converter

ID Number	WPS3
Models	Taycan (Y1A / Y1B)
Model Years	2020-2022
VIN List	Attached
Number of Affected VINs	5
Issue Description	<p>On the affected vehicles, the high-volt battery including the high-volt battery control unit (BMCE) was not replaced in conjunction with the high voltage converter.</p> <p>When switched off, this can lead to a warning message on the instrument cluster "Vehicle electrical system - service required".</p> <p>To prevent this, the high-volt converter must be replaced.</p>
What should Porsche Centers do?	<p>Please arrange for this measure to be carried out as soon as possible on affected vehicles.</p> <p>As of the time of this posting (12/13/23) the remedy is now available.</p> <p>Parts can be ordered as normal via PPL.</p>
TI Number	No. 196-23

Required parts

Part number	Designation	Quantity/vehicle	Parts return*
Vehicles with campaign scope 1 and 2:			
9J1915539CK	Voltage converter HV Booster low	1 piece	Yes

WPS3 Workshop Campaign - Replacing high voltage converter

N 10261307	M10 hexagon nut	2 pieces	No
PAF912040	Hexagon-head bolt, M8 x 50	4 pieces	No

Vehicles with campaign scope 3 and 4:

9J1915539DP	Voltage converter HV Booster low	1 piece	Yes
N 10261307	M10 hexagon nut	2 pieces	No
PAF912040	Hexagon-head bolt, M8 x 50	4 pieces	No

Vehicles with campaign scope 5 and 6:

9J1915539DN	Voltage converter HV Booster high	1 piece	Yes
N 10261307	M10 hexagon nut	2 pieces	No
PAF912040	Hexagon-head bolt, M8 x 50	4 pieces	No

Vehicles with campaign scope 7 and 8:

9J1915539CN	Voltage converter HV Booster high	1 piece	Yes
N 10261307	M10 hexagon nut	2 pieces	No
PAF912040	Hexagon-head bolt, M8 x 50	4 pieces	No

Until the associated warranty or campaign claim has been credited the parts must be stored. If, with the credit note, a barcode is generated, the affected part must be sent to Porsche AG as usual. If no barcode is generated with the credit note, the part can go directly into the remanufactured parts process or be scrapped.

Required materials (usually already available in the Porsche Centre):

Part number	Designation	Quantity/vehicle
00004330516	Coolant additive, 20-litre container	Quantity as required (max. 0.5 liters are required per vehicle)

Warranty processing

Validity:

This workshop campaign will be carried out up to February 7th, 2029 and will be closed on that date.

Please note that warranty claims can only be processed up to this date.

WPS3 Workshop Campaign - Replacing high voltage converter

Scope 1, 3, 5 and 7: Replacing HV voltage converter

- Valid for vehicles for which the workshop campaign was carried out in conjunction with the workshop campaign WPL8

Damage Code	WPS3 66 000
Repair Code	2
Labour time	228 TU

Scope 2, 4, 6 and 8: Replacing HV voltage converter

- Valid for vehicles, for which the WPL8 workshop campaign has already been carried out

Damage Code	WPS3 66 000
Repair Code	2
Labour time	684 TU

Please enter the campaign carried out in the Warranty and Maintenance booklet for the vehicle.

Customer mobility

If requested, mobility for the affected customer can be ensured by offering a suitable replacement transport. Please invoice this additional service via WWS with the campaign scope.

Attachments

1. [VIN_List_Report_WPS3_2023-12-13_V2.xlsx](#)