

GPOP - Issue Review System

Part Number: 68316084A\$, 68316085A\$, 68442528A\$, 68442529A\$, 68477264A\$,
68477265A\$, 68533272A\$, 68533273A\$, 68533274A\$, 68533275A\$

Part Description: FRT RT/LT- LAMP ASSY

Issue Description: For moisture / water found in headlamp please review TSB 23-029-23 Headlamp
Condensation clearing procedure. If the moisture problem persists:

1. Provide picture of headlamp moisture in headlamp after running the TSB.
 2. Check for damage to headlamp lens, housing and flanges. Provide digital pictures of any damage found.
- Please make sure that pictures show location and severity of the damage is on the part.
Please send the pictures along with the VIN, part number and mileage to the following:

FCA Redacted Content