

RAPID UPDATE

FROM: Maserati TSO

TO: Maserati Network



PERSONAL SERVICE LAB

MASTERS OF CARE

Rapid Update 678

Grecale – Intercooler pipe replacement



DATE: DECEMBER 5 2023

Certain Maserati Grecale (M182) MY23 listed in MODISCS+ are involved in a Rapid Update involving the replacement of the intercooler pipe.

A limited batch of vehicles may potentially have been fitted with piping that has a plastic burr in the connection area. Over time, it can detach and cause noise and disruptions in the component's operation. The expectation of this anomaly occurring is very low and is usually detected early by triggering a MIL and setting a P2261 DTC. The procedure consists of replacing the non-compliant component.

We remind you that all the Rapid Updates must be performed within the first workshop visit, regardless of the Mandatory setting set in Modis, as required by Maserati policies.

Also, for vehicles in Stock Dealer / PDI, it is necessary to carry out all action operations before delivery to the end customer, as required by the White Book and explicitly reported in the Pre-delivery checklist.

Please read and review this bulletin first before ordering parts and/or starting the procedure.

Contact your Regional AfterSales Manager (RAM) or the Technical Support Helpdesk if you have any questions.

Thank You for your continued support and cooperation.


Maserati Americas
Aftersales Dept.

Technical Procedure



All images shown in this bulletin are for illustrative purposes only

1. Always check ModisCS+ to see if the vehicle is involved in this action and if it has not been previously performed.
2. Disconnect the battery according to the instructions in the workshop manual:
08.20.001 - BATTERY - Connecting/disconnecting the electrical power supply
3. Open the front hood and carefully remove the engine cover:
09.15.001 - ENGINE COMPARTMENT COVER - Removal/refitting or replacement
4. Use a suitable tool, undo the clips, and carefully remove the intake manifold heat shield, following the instructions in the workshop manual: **Section 09.15 - 1**
(Pos 38) 01.40.060 - INTAKE MANIFOLD HEAT SHIELD - Removal-Refitting or Replacement
5. Disconnect the oil vapor pipe: **Section 01.63 - 1**
01.50.187 - ENGINE OIL VAPOR SUCTION HOSE AT IDLE - Removal-Refitting or Replacement.
6. At this point, you can reach the outlet pipe of the turbocharger. replace the pipe following the workshop manual instructions. **Section 01.32 - 1**
01.40.062 AIR OUTLET PIPE FROM TURBOCHARGER TO MANIFOLD THROTTLE BODY - Removal-Refitting or Replacement

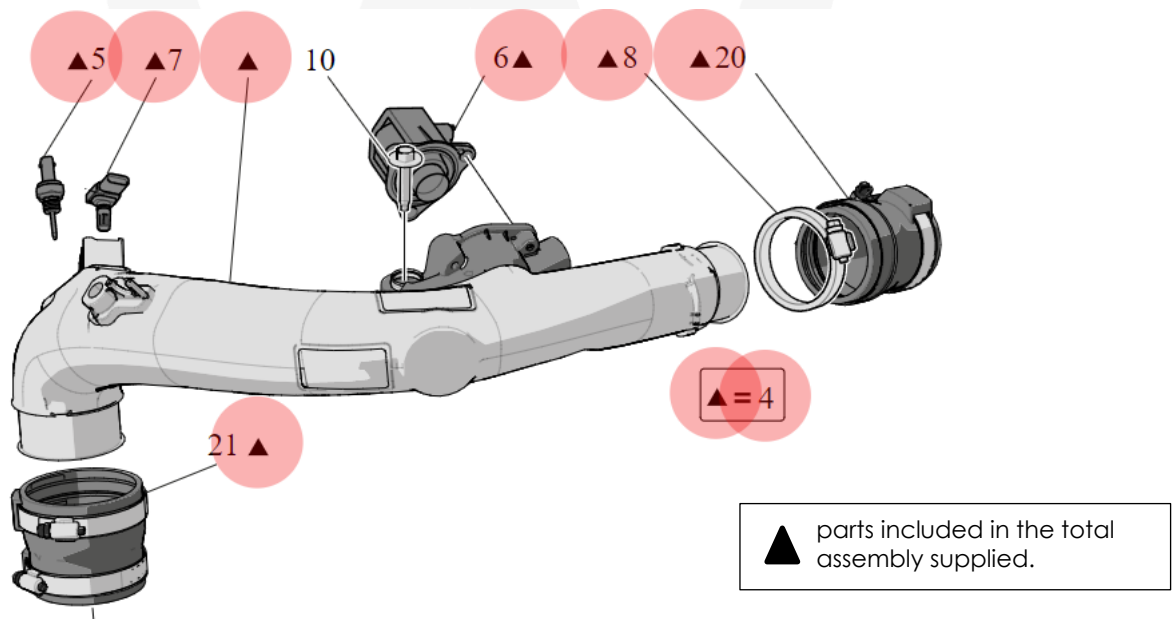

Important! Parts highlighted in red are included with the new pipe. There is no need to transfer these parts from the old one.

7. Re-install any components removed by following the procedures in reverse order.
8. Procedure complete.

Spare Parts

To carry out the Field Action it is necessary to order the following PN's.

SPARE PARTS	QTY	PN
INTERCOOLER DUCT	1	675000989

Warranty Claim

Complete the warranty request as follows:

Description	Code
Rapid Update number	678
Warranty code	23
Error code	063
Component Code	1.40.062
Operation Code	
▪ Component replacement	1.40.062.00 (0.45 h)