



Bulletin No.: PIP5660B

Published date: N/A

## Preliminary Information

### PIP5660B Diagnostic Tip: MIL Illuminated Possible Reduced Engine Power Message with DTC P2101 and/or P1516 Set as Current or History

Proactive

Product Investigation Review Required

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	XT4	2019	All	All	2.0 LSY	All
Chevrolet	Silverado 1500 (New Model)	2019	All	All	2.7 L3B	All
GMC	Sierra 1500 (New Model)	2019	All	All	2.7 L3B	All

Involved Region or Country:	North America
Condition:	MIL Illuminated Possible Reduced Engine Power Message with DTC p2101 and/or P1516 Set as Current or History.
Cause:	Possible Throttle Body Internal Gel Contamination Issue.

Correction

**If you encounter a vehicle with the above condition of DTC P2101 and/or P1516 and the vehicle was built before VIN breakpoint KF207339 replace the throttle body assembly and retest.**

**If the vehicle was built after the VIN breakpoint then proceed with the published SI diagnostics for the related DTC. Also, be sure to verify terminal tension at the ECM and throttle body and confirm no related wiring issues between the ECM and throttle body.**

Warranty Information

For vehicles repaired under the Emission coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation:	Description	Labor Time:
4021510	Throttle body replacement	Use Published Labor Time

Version History

Version	3
Modified	07/15/2019 - Created. 10/24/2019 Updated to add VIN breakpoint information. 12/8/23 - Updated to correct warranty coverage type.



GENERAL MOTORS

© 2024 General Motors. All Rights Reserved.