



Preliminary Information

PIT6103 Intermittent Power Windows Inoperative - Side Object Detection Indicators On - LIN Bus 3 and 4 Offline

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Colorado	2023	All	All	All	All
GMC	Canyon	2023	All	All	All	All

Involved Region or Country:	North America
Condition:	Power windows inoperative, Service Door Latch message, S.O.D. indicators stay on, door switch communications codes and U1502/1503 stored. Condition is usually intermittent.
Cause:	Possible defective diode in one or more of the power window switches.

Correction:

Inspect the parts label on all 4 window switches. If the date code shown below is between 3156 and 3195 replace the switch. Any one or all 4 can be an issue. Do NOT replace any switches outside these breaks.



Warranty Information

For vehicles covered under the Bumper To Bumper Warranty please use published labor times.

Version History

Version	1
Modified	12/13/2023 - Created on.



GENERAL MOTORS