



Preliminary Information

PIT6099A HVAC Controls Inoperative

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Blazer EV	2024	All	All	All	All

Involved Region or Country	North America
Condition	A vehicle may be encountered with HVAC buttons/controls that are inoperative. When pressing the buttons or turning the temperature dials there will be no response. The power button will light up in the HVAC control head.
Cause	Software

Correction:

A new radio software update, version W26E-172.4.2-M169-SQBR4-123.4, was released to service for vehicles equipped with Infotainment system RPO IVD being brought into the service department. In addition to providing general robustness and stability enhancements, this update includes all enhancements from previous software version releases.

In SPS select the A11 Radio - USB Copy/USB File Transfer.
Perform the USB file transfer to install updated software in the A11 Radio.
After completion if a message "If the Calibrate Device is present, reprogram the A11 Radio using SPS2" is displayed, Reprogram the A11 Radio.

Additional SI Keywords

control, controls, heat, heater, HVAC, hvac, inoperative, temperature

Version History

Version	2
Modified	12/07/2023 - Created on. 12/15/2023- Updated PI to add additional statement at beginning of correction.



GENERAL MOTORS