



# Preliminary Information

## PIT5673A Intellibeam headlamp inoperative with UGN - FRONT AUTOMATIC BRAKING

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Enclave	2018 - 2023	All	All	All	All
Cadillac	XT5	2017 - 2023	All	All	All	All
Chevrolet	Blazer	2019 - 2023	All	All	All	All
Chevrolet	Traverse	2018 - 2023	All	All	All	All
GMC	Acadia	2017 - 2023	All	All	All	All

Involved Region or Country	North America
Additional Options (RPO)	UGN - FRONT AUTOMATIC BRAKING
Condition	Intellibeam / (AHBA) Automatic High Beam Assist inoperative and the indicator in the cluster will not come on.
Cause	No low speed data to the camera.

Correction:

Install the data bus tool and see if you have data with the front view camera on low speed, terminal 1. If there is no low speed data to the camera inspect X203 for bent or damaged terminals. If no concerns found with the connector test ckt 5060 for an open. This PI may be converted to a Bulletin in the future if new information becomes available.

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin [10-00-89-005](#) for warranty information on wire/connector repairs.

Version History

Version	2
Modified	04/15/2019 - Created on 12/21/2023- PIT5673A created to update model years on all vehicles



GENERAL MOTORS