	volvo Car Us
VOLVO	Bulletin Title
	Service Action
	Model Year 2
	Car Market
	Canada
	Revisions

Volvo Car USA LLC	Pa	rts Bulletin
Bulletin Title	Group	CAT/NO
Service Action A10258:	46	A10258
Model Year 2024 XC40 and C40		
Car Market	Issue Date	Status Date
Canada	12/20/23	12/20/23
Revisions	Page	
	Page 1 of 1	

Reference Bulletin: QB 46-A10258

Volvo Car Canada LTD, on behalf of Volvo Car Corporation, has decided to launch Active Service Action A10258 on certain Model Year 2024 XC40 and C40 vehicles.

Volvo Cars quality investigations have identified that some vehicles may have been built without the correct torque specification on the Electric Rear Axle Drive (ERAD) transmission housing. As a result, there may be oil seepage and/or noise/vibration.

The corrective action is to inspect the ERAD transmission visually for leaks and follow the instructions outlined in TIE based on the outcome of the inspection.

A10258 affects 1 vehicle in Canada.

Parts Required:

Part Number	Qty	Failing Part	Description
30746563	4		Sems screw
988370	4		Flange screw
30746667	4		Sems screw
30670602	2	F	Sems screw
30746612	4		Sems screw
30746712	4		Sems screw
30735856	2		Expanding ring
31367618	2		Spacer
985930	2		Flange lock nut
32382723	0-1		Transmission oil

No part number for gasket, 10 screws and the special tool that is needed for *Instruction 2*. These are sent, free of charge, to NSC that distributes them to concerned dealer.