	Volvo Car USA LLC		Techni	cal Journal
	Technical Journal Title		Ref. No.	
	Creaking noise from Steeri	ng Wheel Module (SWM)	TJ 35511.2	2.0
<b>\</b>	Issuer (Dept.)		Issue Date	Status Date
VOLVO	Technical Service		3/16/23	3/23/23
	Car Market	Partner	Function Group	
	United States and Canada	3 US 7510 Volvo Car USA	3644	
	Function Description		Page	
	Housing for direction indica	ator switch	Page 1 of 1	4

#### Attachment

File Name	File Size
TJI-519196-1_1_0_en-US.pdf	1.8455 MB
TJI-519196-2_1_0_en-US.pdf	1.9510 MB

Rows beginning with \* are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

#### **DESCRIPTION:**

If creaking / ticking noise is heard from SWM area when turning the steering wheel, then follow advice under Service.

\*Structure week updated.

#### **CSC** Customer Symptom Codes

Code	Description
Н3	Steering wheel/Squeak/rattle/Steering column/wheel
H4	Steering/Unusual noise/Unsure when/at all times
X8	Steering/Unusual noise/At full turn

### **DTC** Diagnostic Trouble Codes

## Vehicle Type

Туре	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
224							2019-2022		-	201835-202148
225							2018-2022		-	201817-202148
227							2019-2022		-	201846-202148
234							2017-2017		-	201617-202148
235							2017-2022		-	201624-202148
236							2017-2022		-	201646-202148
238							2017-2022		-	201646-202148
246							2018-2022		-	201817-202148
256							2016-2022		-	201505-202148

#### SERVICE:

Follow instruction for SPA platform according to the attachment TJI-519196-1\_1\_0\_en-US and for CMA platform according to the attachment TJI-519196-2\_1\_0\_en-US.

#### Warranty claim info:

To get warranty claim accepted for a job described in this TJ, please use following data: VST OP number: 98751-2

#### **VST** Operation Number

VST Operation Number	Description
98751-2	Steering wheel module adjust acc

#### **VEHICLE REPORT:**

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 3644.

## To view TJ attachments continue to next page. This TJ has two attachments.

voivo oai	Customer Service	TJ Instruction VCC-519196-1			
Title Ste	eering wheel module (SWM)	Page	1(6)		
Action Pro	oduct fix	Operation number:	98751-2		


Issue	Date	Reason
1	2020-05	First issue

# Affected vehicles

Model year	Model
2019, 2020	S60 (19-)
2017, 2018,	S90 (17-)
2019, 2020	
2017, 2018,	S90L
2019, 2020	
2019, 2020	V60 (19-)
2019, 2020	V60 Cross Country
	(19-)
2017, 2018,	V90 (17-)
2019, 2020	
2017, 2018,	V90 Cross Country
2019, 2020	
2018, 2019,	XC60 (18-)
2020	
2016, 2017,	XC90 (16-)
2018, 2019,	
2020	


		Materials	
Materials	Qty.	Part No.	Notes
Anti-squeak tape	1.0	1161842	

#### **Color symbols**

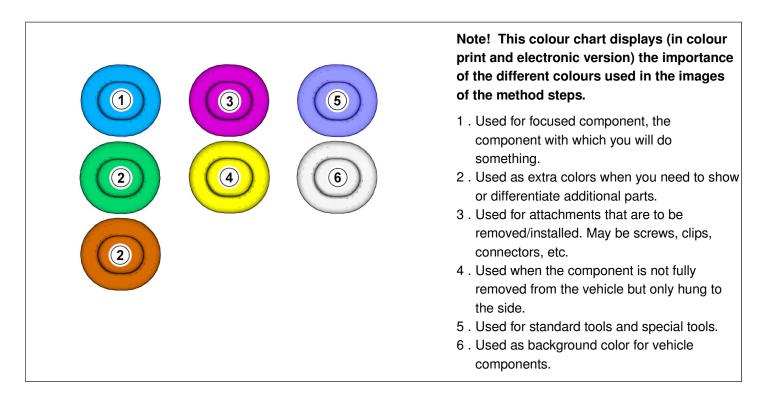


#### Removal

Remove airbag driver's side, refer to:
Removal, replacement and installation
8 - Body and interior
88 - Interior equipment
884 - seat belt and other restraining
systems

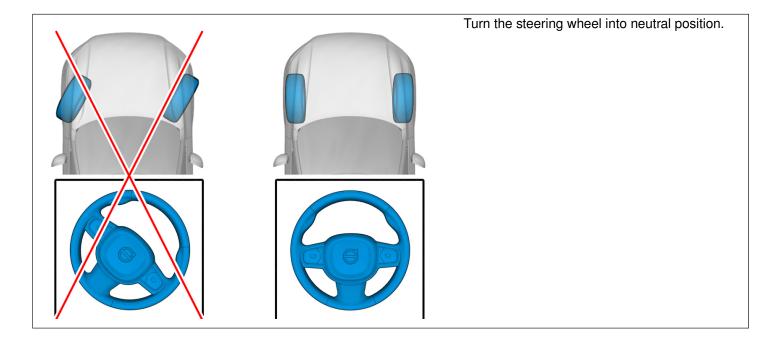


15 mm

# Page 3 ( 6 )

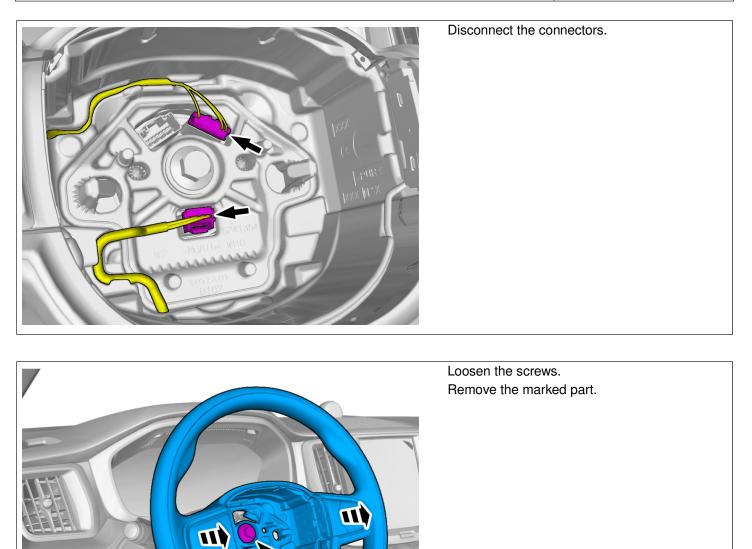


		Note! Orientation view
--	--	------------------------

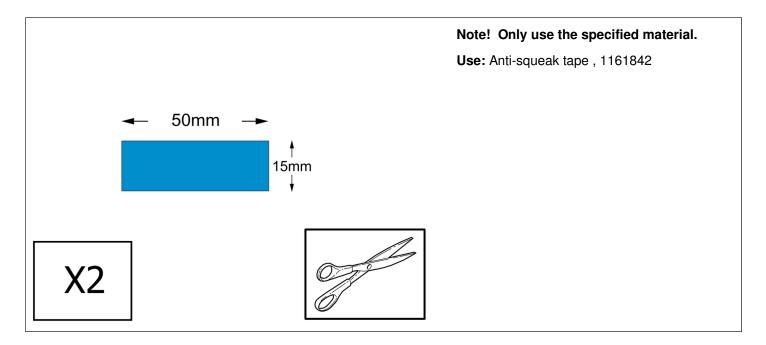


## Page 4 ( 6 )

# Page 5 ( 6 )


Caution! Make sure the component is fitted as illustrated.

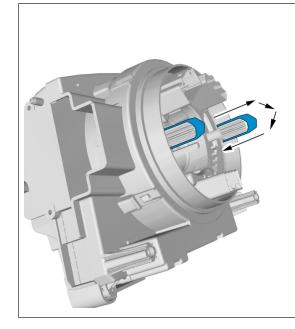

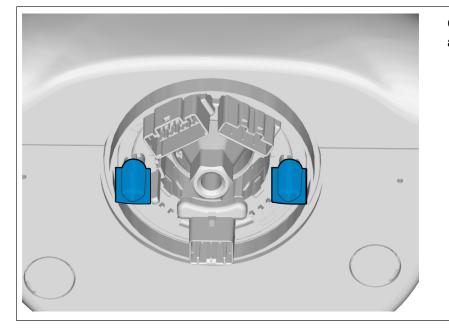

Caution! Make sure the component is fitted as illustrated.

#### Installation

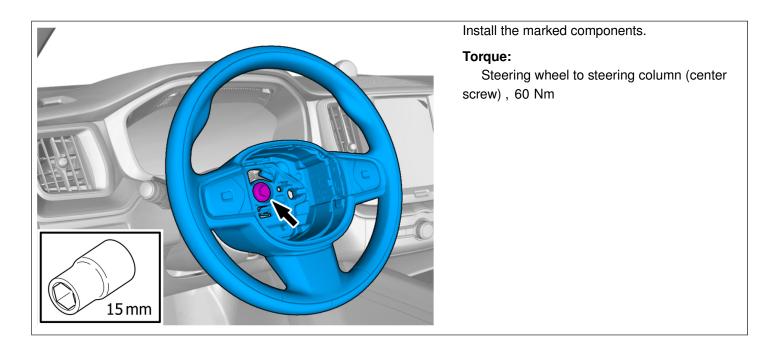

Fit driver's side airbag, refer to: Removal, replacement and installation 8 - Body and interior 88 - Interior equipment 884 - seat belt and other restraining systems

6)
751-2


Issue	Date	Reason
1	2020-05	First issue

# Affected vehicles

Model year	Model	
2018, 2019,	XC40	
2020		


		Materials	
Materials	Qty.	Part No.	Notes
Anti-squeak tape	1.0	1161842	

#### **Color symbols**

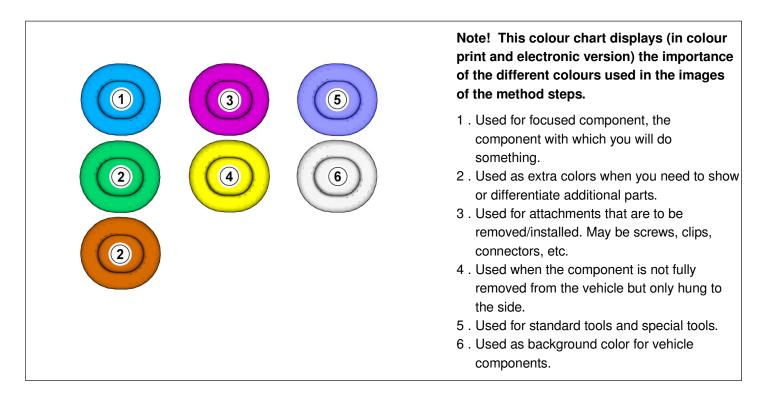


#### Removal

Remove airbag driver's side, refer to:
Removal, replacement and installation
8 - Body and interior
88 - Interior equipment
884 - seat belt and other restraining
systems

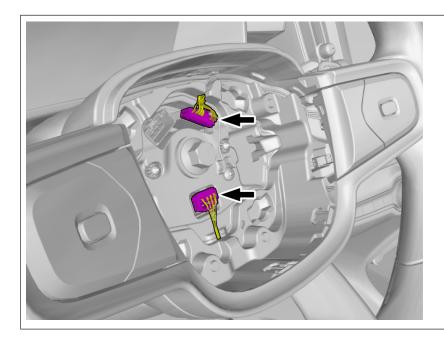


Disconnect the connectors.

# Page 3 ( 6 )

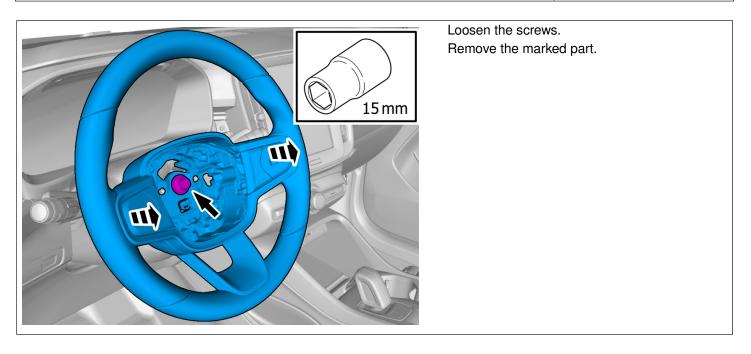


Note! Orientation view

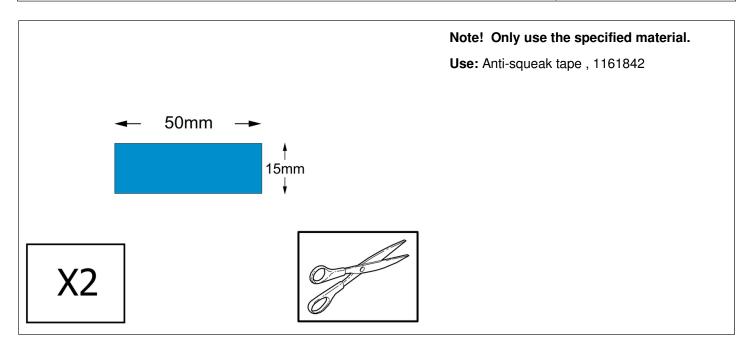


as illustra

Caution! Make sure the component is fitted as illustrated.

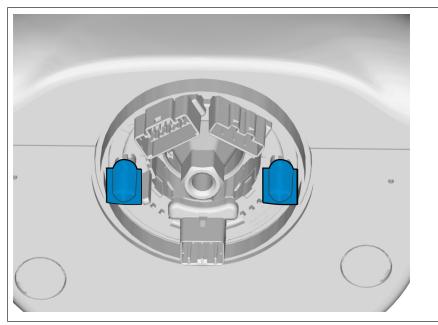


# Caution! Make sure the component is fitted as illustrated.

#### Installation

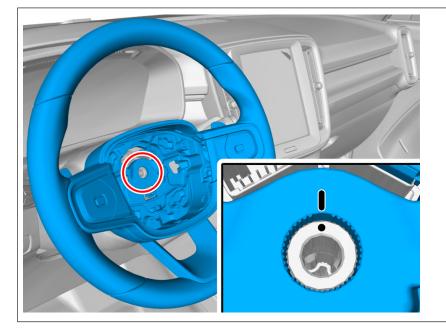

Note! Make sure that the road wheels are in the straight ahead position.

Note! The markings must be opposite each other.

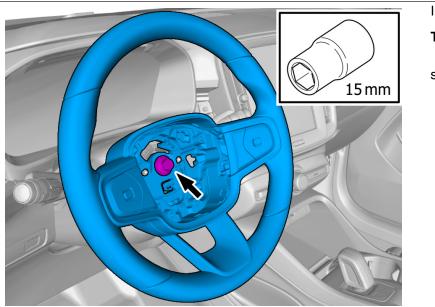

Install the screw.

## Torque:

Steering wheel to steering column (center screw) , 60 Nm

Fit driver's side airbag, refer to:			
Removal, replacement and installation			
8 - Body and interior			
88 - Interior equipment			
884 - seat belt and other restraining			
systems			