



Service Bulletin

Bulletin No.: 21-NA-238

Date: January, 2024

TECHNICAL

Subject: Transmission Fluid Leak Near Bellhousing Area

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Silverado 2500HD/ 3500HD	2020	2024			L5P	MGM, MGU, MKM
GMC	Sierra 2500HD/ 3500HD						

Involved Region or Country	North America, Australia, New Zealand.
Condition	Some customers may comment that a transmission fluid leak is coming from the bellhousing inspection cover.
Cause	This condition may be caused by the Automatic Transmission Case Front Cover Seal may be rolled or damaged.
Correction	If the leak has been verified to be coming from the front cover seal, replace the Automatic Transmission Case Front Cover Seal and the Torque Converter Fluid Seal.

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Service Procedure

Refer to *Automatic Transmission Case Front Cover Removal in SI* and *Torque Converter Fluid Seal Replacement in SI*.

Parts Information

Causal Part	Description	Part Number	Qty
X	SEAL, T/C FLUID	24293986	1
X	SEAL AUTO TRANS FRT CASE COVER	24277112	1
N/A	SEAL, TRANS FLUID CLR PIPE	84792610	1
N/A	PLATE, CLU PRESS	24287670	1
N/A	BOLT/SCREW-A/ TRNS CASE FRT CVR	11604747	15
N/A	BOLT, TRNS MNT	11548787	2
N/A	NUT, TRNS MNT	11548414	3
N/A	SEAL, OUTPUT SEAL SQUARE CUT	24286193	1
N/A	FLUID, AUTO TRNS ULV	19352619 (U.S.) 19352620 (Canada)	15

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
8466580	Automatic Transmission Case Front Cover Seal Replacement	Use the Published Labor Operations Time

Version	4
Modified	Released November 09, 2021 Revised February 17, 2022 - Add 2022 to Model Year. Revised January 19, 2023 - Added Plate, Clutch Pressure and SEAL, TRANS FLUID CLR PIPE to Parts Information section. Revised January 03, 2024 - Added 2023 to 2024 Model Years, Added RPO MKM and Added 11604747 to Parts Information section.

