

Technical Service Bulletin

90 Pre sense malfunction/driver assist systems sporadically inop, DTC B200FF9 is stored in the driver assist module

90 24 69 2072619/1 January 4, 2024.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6, A7, A8, and Q8	2019 – 2020		
e-tron quattro	2019		
A6 allroad, S6, S7, S8, e-tron Sportback quattro, Q7, SQ7, SQ8, and RS Q8	2020	All	Not Applicable

Condition

Customer states:

• The vehicle driver assistance systems are sporadically not working.

One of the following messages may be displayed in the instrument cluster:

- Audi adaptive light malfunction.
- Audi pre sense system malfunction.
- Adaptive vehicle assistance is restricted.
- Adaptive vehicle assistance Predictive regulation restricted.

After an ignition cycle or bus sleep, the systems are available again.

Workshop findings:

The following DTC is stored sporadically in the driver assistance systems control module, J1121 (address word 00A5):

• DTC B200FF9 (internal malfunction) with symptom code 2117657.

Technical Background

The control module's diagnostic checks are too sensitive.

Production Solution

Not applicable.

Page 1 of 2

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

^{© 2023} Audi of America, Inc.



Technical Service Bulletin

Service

This TSB replaces Pending Service Solution (PSS) TSB 2061489: PSS 90 Parking aid inop, DTC B107A16 stored in the driver assistance system with symptom code 233474.

- 1. Delete the DTC B200FF9 and release the vehicle back to the customer.
- 2. Explain to the customer that, due to its sporadic and infrequent nature, it is unlikely that customers will experience this issue again after the affected DTC has been deleted.

Warranty

This TSB is informational only and not applicable to any Audi Warranty.

Additional Information

All part and service references provided in this TSB (**2072619**) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.

©2024 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies, and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

© 2023 Audi of America, Inc.

Page 2 of 2

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.